



Standard Test Method for Determining Plane-Strain Crack-Arrest Fracture Toughness, K_{Ia} , of Ferritic Steels¹

This standard is issued under the fixed designation E1221; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

1. Scope

1.1 This test method employs a side-grooved, crack-line-wedge-loaded specimen to obtain a rapid run-arrest segment of flat-tensile separation with a nearly straight crack front. This test method provides a static analysis determination of the stress intensity factor at a short time after crack arrest. The estimate is denoted K_a . When certain size requirements are met, the test result provides an estimate, termed K_{Ia} , of the plane-strain crack-arrest toughness of the material.

1.2 The specimen size requirements, discussed later, provide for in-plane dimensions large enough to allow the specimen to be modeled by linear elastic analysis. For conditions of plane-strain, a minimum specimen thickness is also required. Both requirements depend upon the crack arrest toughness and the yield strength of the material. A range of specimen sizes may therefore be needed, as specified in this test method.

1.3 If the specimen does not exhibit rapid crack propagation and arrest, K_a cannot be determined.

1.4 The values stated in SI units are to be regarded as the standards. The values given in parentheses are provided for information only.

1.5 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

2. Referenced Documents

2.1 *ASTM Standards*:²

E8 Test Methods for Tension Testing of Metallic Materials

¹ This test method is under the jurisdiction of ASTM Committee E08 on Fatigue and Fracture and is the direct responsibility of Subcommittee E08.07 on Fracture Mechanics.

Current edition approved May 1, 2012. Published July 2012. Originally approved in 1988. Last previous edition approved in 2010 as E1221 – 10. DOI: 10.1520/E1221-12.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

E23 Test Methods for Notched Bar Impact Testing of Metallic Materials

E208 Test Method for Conducting Drop-Weight Test to Determine Nil-Ductility Transition Temperature of Ferritic Steels

E399 Test Method for Linear-Elastic Plane-Strain Fracture Toughness K_{Ic} of Metallic Materials

E616 Terminology Relating to Fracture Testing³

E1304 Test Method for Plane-Strain (Chevron-Notch) Fracture Toughness of Metallic Materials

E1823 Terminology Relating to Fatigue and Fracture Testing

3. Terminology

3.1 *Definitions*:

3.1.1 Definitions in Terminology **E1823** are applicable to this test method.

3.2 *Definitions of Terms Specific to This Standard*:

3.2.1 *conditional value of the plane-strain crack-arrest fracture toughness, K_{Qa} ($FL^{-3/2}$)*—the conditional value of K_{Ia} calculated from the test results and subject to the validity criteria specified in this test method.

3.2.1.1 *Discussion*—In this test method, side-grooved specimens are used. The calculation of K_{Qa} is based upon measurements of both the arrested crack size and of the crack-mouth opening displacement prior to initiation of a fast-running crack and shortly after crack arrest.

3.2.2 *crack-arrest fracture toughness, K_A ($FL^{-3/2}$)*—the value of the stress intensity factor shortly after crack arrest as determined from dynamic methods of analysis.

3.2.2.1 *Discussion*—The in-plane specimen dimensions must be large enough for adequate enclosure of the crack-tip plastic zone by a linear-elastic stress field.

3.2.3 *crack-arrest fracture toughness, K_a ($FL^{-3/2}$)*—the value of the stress intensity factor shortly after crack arrest, as determined from static methods of analysis.

³ Withdrawn. The last approved version of this historical standard is referenced on www.astm.org.

3.2.3.1 *Discussion*—The in-plane specimen dimensions must be large enough for adequate enclosure of the crack-tip plastic zone by a linear-elastic stress field.

3.2.4 *plane-strain crack-arrest fracture toughness, K_{Ia} ($FL^{-3/2}$)*—the value of crack-arrest fracture toughness, K_{Ia} , for a crack that arrests under conditions of crack-front plane-strain.

3.2.4.1 *Discussion*—The requirements for attaining conditions of crack-front plane-strain are specified in the procedures of this test method.

3.2.5 *stress intensity factor at crack initiation, K_o ($FL^{-3/2}$)*—the value of K at the onset of rapid fracturing.

3.2.5.1 *Discussion*—In this test method, only a nominal estimate of the initial driving force is needed. For this reason, K_o is calculated on the basis of the original (machined) crack (or notch) size and the crack-mouth opening displacement at the initiation of a fast-running crack.

4. Summary of Test Method

4.1 This test method estimates the value of the stress intensity factor, K , at which a fast running crack will arrest. This test method is made by forcing a wedge into a split-pin, which applies an opening force across the crack starter notch in a modified compact specimen, causing a run-arrest segment of crack extension. The rapid run-arrest event suggests need for a dynamic analysis of test results. However, experimental observations (1, 2)⁴ indicate that, for this test method, an adjusted static analysis of test results provides a useful estimate of the value of the stress intensity factor at the time of crack arrest.

4.2 Calculation of a nominal stress intensity at initiation, K_o , is based on measurements of the machined notch size and the crack-mouth opening displacement at initiation. The value of K_a is based on measurements of the arrested crack size and the crack-mouth opening displacements prior to initiation and shortly after crack arrest.

5. Significance and Use

5.1 In structures containing gradients in either toughness or stress, a crack may initiate in a region of either low toughness or high stress, or both, and arrest in another region of either higher toughness or lower stress, or both. The value of the stress intensity factor during the short time interval in which a fast-running crack arrests is a measure of the ability of the material to arrest such a crack. Values of the stress intensity factor of this kind, which are determined using dynamic methods of analysis, provide a value for the crack-arrest fracture toughness which will be termed K_A in this discussion. Static methods of analysis, which are much less complex, can often be used to determine K at a short time (1 to 2 ms) after crack arrest. The estimate of the crack-arrest fracture toughness obtained in this fashion is termed K_a . When macroscopic dynamic effects are relatively small, the difference between K_A and K_a is also small (1-4). For cracks propagating under conditions of crack-front plane-strain, in situations where the dynamic effects are also known to be small, K_{Ia} determinations using laboratory-sized specimens have been used successfully

to estimate whether, and at what point, a crack will arrest in a structure (5, 6). Depending upon component design, loading compliance, and the crack jump length, a dynamic analysis of a fast-running crack propagation event may be necessary in order to predict whether crack arrest will occur and the arrest position. In such cases, values of K_{Ia} determined by this test method can be used to identify those values of K below which the crack speed is zero. More details on the use of dynamic analyses can be found in Ref (4).

5.2 This test method can serve at least the following additional purposes:

5.2.1 In materials research and development, to establish in quantitative terms significant to service performance, the effects of metallurgical variables (such as composition or heat treatment) or fabrication operations (such as welding or forming) on the ability of a new or existing material to arrest running cracks.

5.2.2 In design, to assist in selection of materials for, and determine locations and sizes of, stiffeners and arrestor plates.

6. Apparatus

6.1 The procedure involves testing of modified compact specimens that have been notched by machining. To minimize the introduction of additional energy into the specimen during the run-arrest event, the loading system must have a low compliance compared with the test specimen. For this reason a wedge and split-pin assembly is used to apply a force on the crack line. This loading arrangement does not permit easy measurement of opening forces. Consequently, opening displacement measurements in conjunction with crack size and compliance calibrations are used for calculating K_o and K_a .

6.2 Loading Arrangement:

6.2.1 A typical loading arrangement is shown in Fig. 1. The specimen is placed on a support block whose thickness should be adequate to allow completion of the test without interference between the wedge and the lower crosshead of the testing machine. The support block should contain a hole that is aligned with the specimen hole, and whose diameter should be between 1.05 and 1.15 times the diameter of the hole in the specimen. The force that pushes the wedge into the split-pin is transmitted through a force transducer.

6.2.1.1 The surfaces of the wedge, split-pin, support block, and specimen hole should be lubricated. Lubricant in the form of thin (0.13 mm or 0.005 in.) strips of TFE-fluorocarbon is preferred. Molybdenum disulfide (both dry and in a grease vehicle) and high-temperature lubricants can also be used.

6.2.1.2 A low-taper-angle wedge and split-pin arrangement is used. If grease or dry lubricants are used, a matte finish (grit blasted) on the sliding surfaces may be helpful in avoiding galling. The split-pin must be long enough to contact the full specimen thickness, and the radius must be large enough to avoid plastic indentations of the test specimen. In all cases it is recommended that the diameter of the split-pin should be 0.13 mm (0.005 in.) less than the diameter of the specimen hole. The wedge must be long enough to develop the maximum expected opening displacement. Any air or oil hardening tool steel is suitable for making the wedge and split-pins. A hardness in the range from R_C 45 to R_C 55 has been used successfully. With the recommended wedge angle and proper lubrication, a loading

⁴ The boldface numbers in parentheses refer to the list of references at the end of this test method.

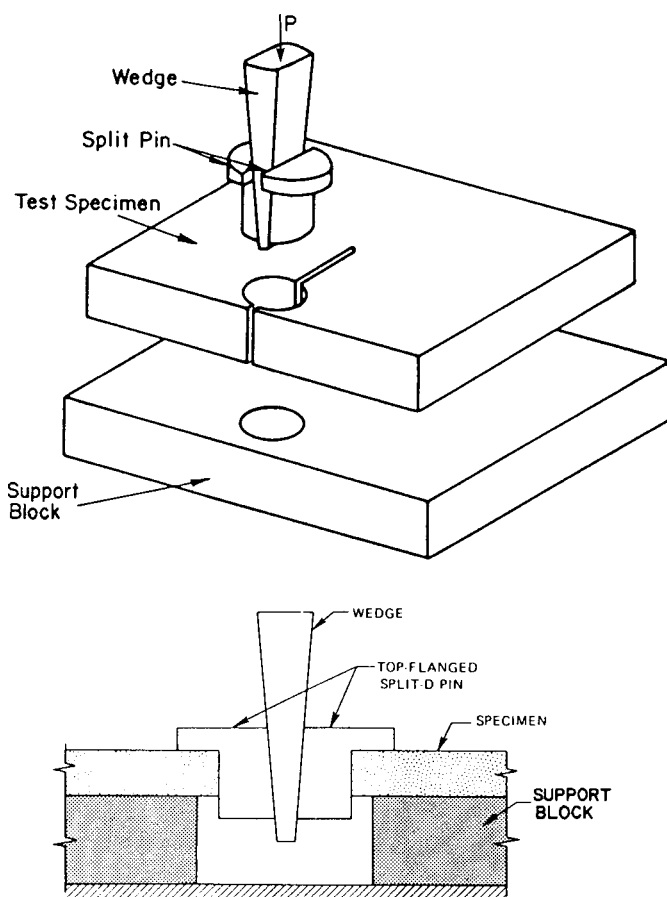


FIG. 1 Schematic Pictorial and Sectional Views Showing the Standard Arrangement of the Wedge and Split-Pin Assembly, the Test Specimen, and the Support Block

machine producing $\frac{1}{5}$ to $\frac{1}{10}$ the expected maximum opening force is adequate. The dimensions of a wedge and split-pin assembly suitable for use with a 25.4-mm (1.0-in.) diameter loading hole are shown in Fig. 2. The dimensions should be scaled when other hole diameters are used. A hole diameter of 1.0 in. has been found satisfactory for specimens having $125 < W < 170$ mm ($5 < W < 6.7$ in.).

NOTE 1—Specimens tested with the arrangement shown in Fig. 1 may not exhibit an adequate segment of run-arrest fracturing, for example, at testing temperatures well above the NDT temperature. In these circumstances, the use of the loading arrangement shown in Fig. 3 has been found to be helpful (2, 7) and may be employed.

6.3 Displacement Gages—Displacement gages are used to measure the crack-mouth opening displacement at $0.25W$ from the load-line. Accuracy within 2 % over the working range is required. Either the gage recommended in Test Method E399 or a similar gage modified to accommodate conical seats is satisfactory. It is necessary to attach the gage in a fashion such that seating contact with the specimen is not altered by the jump of the crack. Two methods that have proven satisfactory for doing this are shown in Fig. 4. Other gages can be used so long as their accuracy is within 2 %.

7. Specimen Configuration, Dimensions, and Preparation

7.1 Standard Specimen:

7.1.1 The configuration of a compact-crack-arrest (CCA) specimen that is satisfactory for low- and intermediate-strength steels is shown in Fig. 5. (In this context, an intermediate-strength steel is considered to be one whose static yield stress, σ_{YS} , is of the order of 700 MPa (100 ksi) or less.)

7.1.1.1 The thickness, B , shall be either full product plate thickness or a thickness sufficient to produce a condition of plane-strain, as specified in 9.3.3.

7.1.1.2 Side grooves of depth $B/8$ per side shall be used. For alloys that require notch-tip embrittlement (see 7.1.3.2) the side grooves should be introduced after deposition of the brittle weld.

7.1.1.3 The specimen width, W , shall be within the range $2B \leq W \leq 8B$.

7.1.1.4 The displacement gage shall measure opening displacements at an offset from the load line of $0.25W$, away from the crack tip.

7.1.2 Specimen Dimensions:

7.1.2.1 In order to limit the extent of plastic deformation in the specimen prior to crack initiation, certain size requirements must be met. These requirements depend upon the material yield strength. They also depend upon K_{Ia} , and therefore the K_{Ia} needed to achieve an appropriate run-arrest event.

7.1.2.2 The in-plane specimen dimensions must be large enough to allow for the linear elastic analysis employed by this test method. These requirements are given in 9.3.2 and 9.3.4, in terms of allowable crack jump lengths.

7.1.2.3 For a test result to be termed plane-strain (K_{Ia}) by this test method, the specimen thickness, B , should meet the requirement given in 9.3.3.

7.1.3 Starting Notch:

7.1.3.1 The function of the starting notch is to produce crack initiation at an opening displacement (or wedging force) that will permit an appropriate length of crack extension prior to crack arrest. Different materials require different starter notch preparation procedures.


7.1.3.2 The recommended starter notch for low- and intermediate-strength steels is a notched brittle weld, as shown in Fig. 6. It is produced by depositing a weld across the specimen thickness. Guidelines on welding procedures are given in Appendix X1.

7.1.3.3 Alternative crack starter configurations (8) and embrittlement methods may also be used. Examples of both alternative configurations and alternative test methods are also described in Appendix X1.

7.1.3.4 While it is expected that a_o values for the starting notch will typically lie in the range $0.30 W \leq a_o \leq 0.40 W$, it is sometimes useful to utilize values as low as $0.20 W$. The lower initial value of a_o/W results in a greater and quicker drop in the crack driving force as the crack extends. This may aid in arresting the running crack at a shorter final crack length and could be useful for conditions where the crack extension is too great with larger initial a_o/W values.

8. Procedure

8.1 *Number of Tests*—It is recommended that at least three valid test results be obtained at a single test temperature.

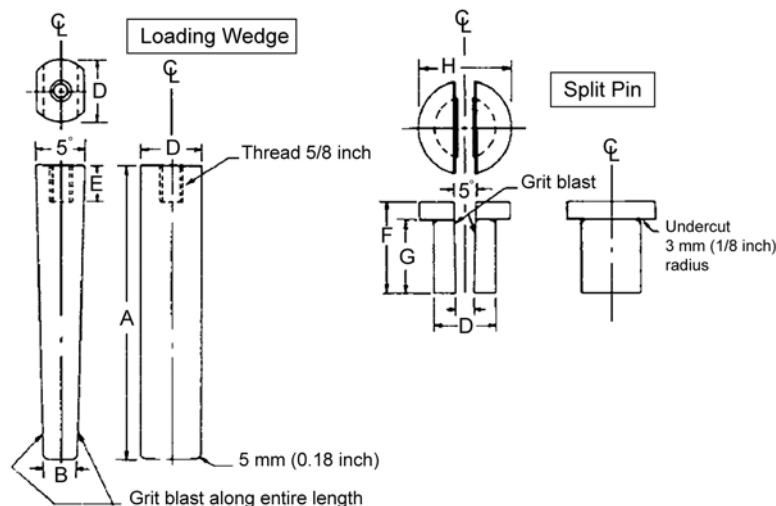

	mm	in.
A	203	8.00
B	8.4	0.33
D	25.1	0.99
E	25.4	1.00
F	57.2	2.25
G	50.8	2.00
H	1.50	38.1

NOTE 1—The dimensions given are suitable for use with a 25.4 mm (1.0 in.) diameter loading hole in a 50.8 mm (2.0 in.) thick test specimen. These dimensions should be scaled appropriately when other hole diameters and specimen thicknesses are used.

FIG. 2 Suggested Geometry and Dimensions of a Wedge and Split-Pin Assembly

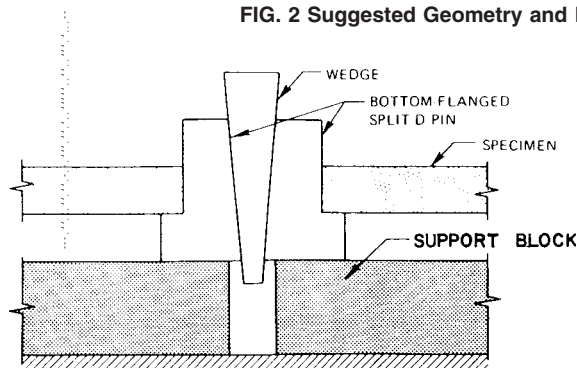


FIG. 3 Sectional View of a Loading Arrangement That May Be Helpful When Testing Specimens at Higher Temperatures

8.2 *Specimen Measurement*—Measure the specimen thickness, B , and the crack plane thickness, B_N , to $\pm 1\%$ of B . Measure the specimen width, W , to $\pm 1\%$ of W .

8.3 Temperature Control and Measurement:

8.3.1 Specimens may be heated or cooled to the selected test temperature by any appropriate method. A method that has been used successfully for elevated-temperature tests employs electric-resistance heating tapes in combination with a variable power source. Tests at subambient temperatures have been conducted using cooling coils embedded in the specimen support block (see Fig. 7); a controlled flow of liquid nitrogen or other suitable coolant through the cooling coils permits low temperatures to be reached without difficulty. To minimize temperature gradients through the specimen thickness, it is necessary to surround the specimen with a good thermal


insulator. Prior to starting the test, the specimen should be held at the test temperature for a time sufficient to allow the specimen to attain a uniform temperature (to within 5°F (3°C)).

8.3.2 Measure the specimen temperature with a thermocouple welded to the top surface of the specimen at a location near the side groove, about 25 mm (1 in.) ahead of the starter notch. In reporting the test results, the test temperature shall be the temperature measured on the specimen at the time of the rapid run-arrest event.

8.4 Loading Procedure:

8.4.1 The test method calls for the use of a cyclic loading technique. In this technique, force is applied to the wedge until a rapid crack initiates, or until the crack-mouth opening displacement (measured by the clip gage) reaches a predetermined value. If a rapid fracture has not initiated prior to the recommended maximum displacement being reached, the specimen is unloaded until the wedge loses contact with the split-pin. The specimen is then reloaded in the same manner as before and force application is once again terminated either by initiation of a rapid crack or upon the opening displacement reaching a specified value. Successively higher values of the recommended maximum opening displacement are allowed on each loading cycle, until a rapid crack initiates or until the test is discontinued.

8.4.2 The loading technique of this test method does not allow direct measurement of the opening forces applied to the specimen by the wedge and split-pin assembly. The force

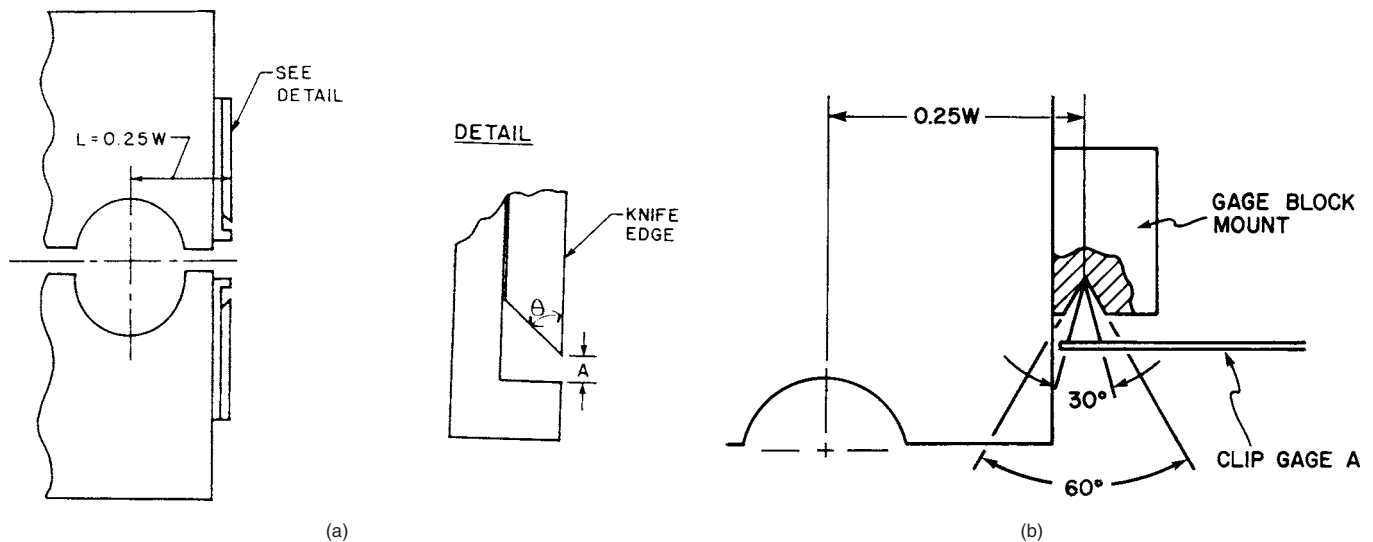

NOTE 1—Dimension A should be 0.002–0.010 in. (0.05–0.25 mm) less than the thickness of the clip gage arm.
 NOTE 2—The knife edge can be attached to the specimen with mechanical fasteners or adhesives.
 NOTE 3—The clip gage is installed by sliding it into the gap.

FIG. 4 Two Alternative Clip Gage Seating Arrangements Using (a) Knife Edges and (b) Using Conical Mounts


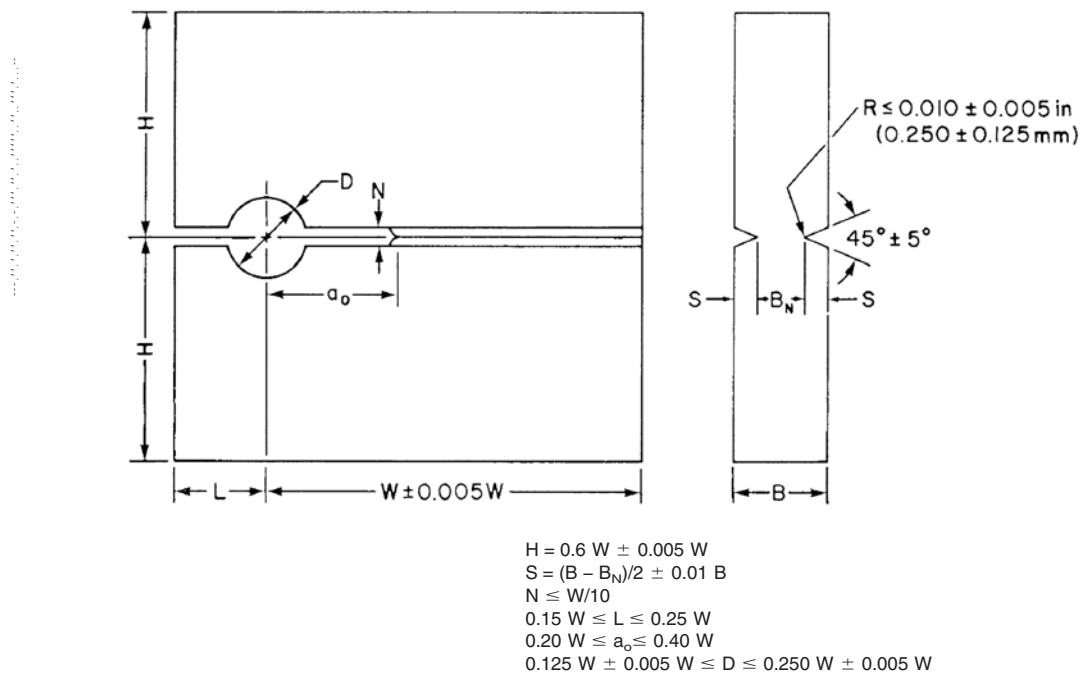


FIG. 5 Geometry and Dimensions of a Crack-Line-Wedge-Loaded Compact-Crack-Arrest (CCA) Test Specimen that is Satisfactory for Low and Medium Strength Steels

applied to the specimen is therefore obtained from measurements of the crack-mouth opening displacement. Components of the opening displacement that do not contribute to the opening force can occur. These have their origin primarily in seating of the load train and clip gage, local cracking in the brittle weld, and interference with crack closure due to incomplete strain reversal in the plastic zone near the root of the starter notch. The purpose of the cyclic loading technique is to identify and estimate the magnitude of these contributions.

8.4.3 The effects of load train seating and weld bead cracking can essentially be limited to the first loading cycle by an appropriate limit on the maximum opening displacement imposed in that cycle. This limit is designed to keep the first loading cycle linear elastic in a global sense. These influences can then be eliminated, with some degree of conservatism, by excluding the zero-force displacement offset recorded at the end of the first loading cycle from the displacement used to calculate K_a .

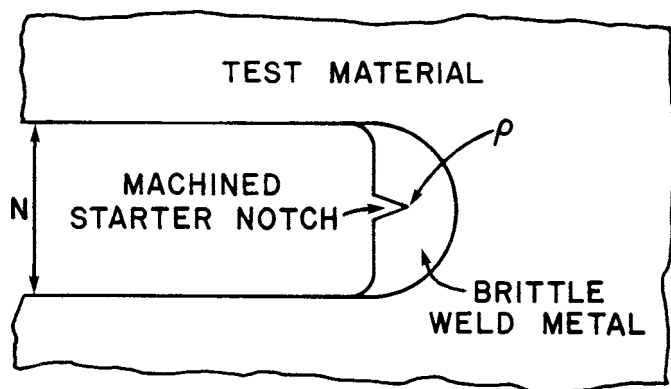

NOTE 1—Dimension N must be large enough to allow entry of the welding electrode being used.

FIG. 6 Details of the Notched Brittle Weld that is Recommended for Use as a Crack Starter for Low and Medium Strength Steels

8.4.4 The second undesirable contribution to the total measured crack opening displacement is due to the local yielding that occurs around the root of the starter notch prior to initiation of a rapid fracture. The formation and growth of this plastic zone can be regarded as being mainly responsible for the zero-force displacement offsets that are recorded after completion of the first loading cycle, that is, between Cycles 2 and 3, 3 and 4, etc. The influence of this effect could be eliminated in its entirety by excluding all of the zero-force offset in opening displacement measured prior to the start of the loading cycle during which the run-arrest event occurs. However, there is evidence to suggest that such a step may be overly conservative. Model tests have shown that, when the plastic zone is well enclosed by the linear elastic stress field in the specimen, nearly all of the offset in the zero-force displacement is recovered if the plastic zone is severed by a saw cut or by a brittle crack (9). The degree to which this component of the strain energy stored in the specimen is recovered in time to influence the run-arrest behavior of the rapid crack is unclear at the present time. The K -calculation procedure of this test method therefore avoids the extremes of excluding all or none of the zero-force displacement offsets which accumulate in the second and subsequent loading cycles, and excludes one half of these effects.

8.4.5 An autographic record of wedge-force versus crack-mouth-opening-displacement should be obtained. The recorder should not be re-zeroed between loading cycles since knowledge of the accumulated zero-force displacement offset is desired. It could also be useful to obtain information about the final segment of the opening-displacement versus time record on an oscillograph or other high-rate recording device. This would provide additional information about the nature of the run-arrest event.

8.4.6 Apply force to the wedge until the crack-mouth-opening-displacement measured by the clip gage reaches the recommended maximum value given by:

$$[(\delta_o)_1]_{\max} = \frac{0.69 \sigma_{YS} W \sqrt{B_N/B}}{Ef(a_o/W)} \quad (1)$$

where:

σ_{YS} = static yield strength of the specimen material (or, in the case of the duplex specimen, of the crack-starter-section material).

The other terms are as defined in 9.2. The testing machine should be operated in displacement control, with a free-running crosshead speed of 2 to 12 mm/min (0.1 to 0.5 in./min).

NOTE 2—Rapid fracture initiation on the first loading cycle is unlikely in the brittle weld CCA specimen. However, if a run-arrest event does occur, proceed with the calculations of K_o and K_a in the same manner as if sequential load-unload cycling had been used. In subsequent tests of replicate specimens, the first cycle displacement limit should be reduced sufficiently so that the first loading cycle can be completed without intervention of a rapid fracture.

8.4.7 Unload the specimen by extracting the wedge in preparation for a second loading cycle. The clip gage should remain in place during unloading and wedge removal to maintain a record of the displacement offset that occurs upon a return to zero force.

NOTE 3—Wedge extraction and cyclic loading can be simplified greatly by the use of the arrangement shown schematically in Fig. 7. Key features include a hold-down plate and a wedge that is fastened to the loading ram. However, the hold-down plate may not be required when using lubricant in the form of TFE-fluorocarbon strips (see 6.2.1.1).

8.4.8 Without re-zeroing the recorder, reinsert and apply force to the wedge at the same displacement rate as on the first cycle. Continue loading until a rapid crack jump occurs or until the displacement measured with the clip gage reaches a predetermined value. The recommended maximum opening displacement on the second and subsequent cycles can be calculated from

$$[(\delta_o)_n]_{\max} = [1.0 + 0.25(n - 1)] \left[\frac{0.69 \sigma_{YS} W \sqrt{B_N/B}}{Ef(a_o/W)} \right] \quad (2)$$

where:

n = cycle number.

The other terms are the same as in (Eq 1). If an unstable crack is not initiated upon reaching the prescribed displacement limit, again unload and extract the wedge as specified in 8.4.7. Label the force/displacement record with the appropriate cycle number and repeat 8.4.8.

NOTE 4—If a large number of load/unload cycles are required, it may be necessary to relubricate the wedge and split-pin assembly. Increased friction will be indicated by an increased slope in the force-displacement record and the need for large reverse loads to extract the wedge.

8.4.9 To measure K_a , a segment of unstable crack extension must occur. The occurrence of unstable crack extension will normally be apparent to the operator, both audibly and as an abrupt force drop on the test record. (In the brittle weld CCA specimen, a force drop of 50 to 60 % has been found to indicate that a sufficient length of unstable fracturing has occurred.) After the event, the operator should remove the force on the wedge to avoid further crack propagation.

8.4.10 If on subsequent loading cycles, it is observed that attempts to increase the opening displacement are accompanied by a decrease in the applied wedge load, that is, stable tearing is occurring, it is unlikely that the specimen will exhibit rapid

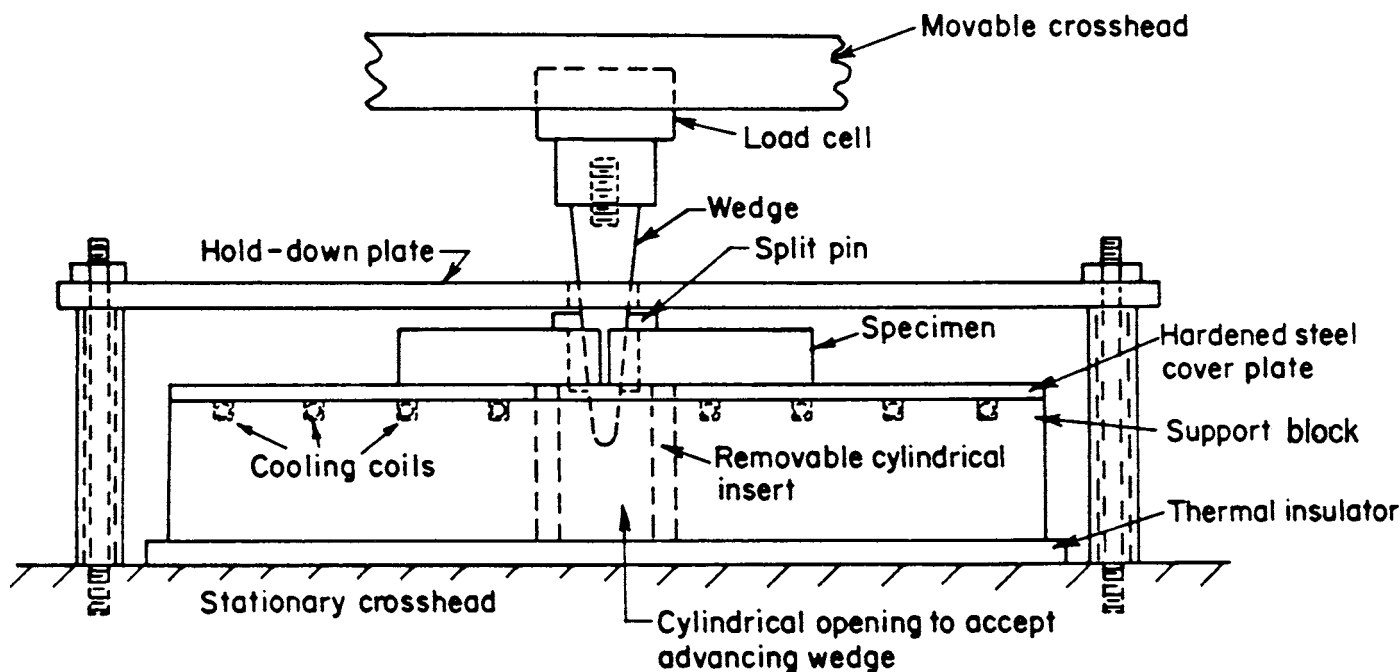


FIG. 7 Schematic Illustration of a Loading Arrangement that Facilitates Wedge Extraction When Using the Cyclic Loading Technique

run-arrest fracturing. It is recommended that under these circumstances, the test be discontinued. It may be helpful at this point to remachine the specimen to remove the weld bead and the material ahead of the starter notch that has been subjected to plastic deformation. A fresh starter notch can then be prepared and the specimen retested at a lower temperature (20 to 40°C (35 to 70°F) lower) in an attempt to obtain useful data from the specimen.

NOTE 5—A displacement limit beyond which the specimen is unlikely to give successful results can be estimated from the following equation:

$$[\delta_o]_{\text{limit}} = \frac{1.50 \sigma_{YS} W \sqrt{B_N/B}}{E f(a_o/W)} \quad (3)$$

which is approximately twice the quantity calculated from (Eq 1).

NOTE 6—The quantity of material that must be removed from an unsuccessful specimen can be approximated by the radius of the plastic zone surrounding the starter notch under plane strain conditions, and calculated from $(K_o/\sigma_{YS})^2/6\pi$. A sufficient quantity of material must be machined out to remove any stable tearing that may have occurred.

8.5 Marking the Arrested Crack:

8.5.1 The position of the arrested crack can be marked by heat tinting. Heating at temperatures in the range 260 to 370°C (500 to 700°F) for 10 to 90 min has proved successful. Any time and temperature combination that clearly marks the arrested crack front is acceptable. The appearance of heat tinting on freshly machined (or ground and sanded) surfaces may provide a clue to the heat tinting progress on the fracture surfaces. If a fractographic examination of the fracture surfaces is to be performed, the use of lower heat tinting temperatures or the marking of the arrested crack front by means of fatigue may be desirable.

8.5.2 After marking the crack front the specimen is broken completely in two. This can usually be done with the wedging apparatus used in testing the specimen. The breaking open of

structural steel specimens is greatly facilitated by cooling them in dry ice or liquid nitrogen.

8.6 Measurement of Arrested Crack Size:

8.6.1 The heat-tinted fracture surface should first be examined to determine whether it displays irregularities serious enough to warrant exclusion of the test result. The occurrence of tunnelling, a failure to follow the side grooves on one or both sides, and the presence of large, unbroken ligaments on the fracture surface are all behaviors that may give erroneous results for K_a . Annex A1 provides more detailed information on this subject.

8.6.2 The average of three measurements defines the arrested crack size, a_a . These measurements are to be made on the heat-tinted fracture surface, to within 1 %, at the following positions: at the center (mid-thickness) of the specimen, and midway between the center and the bottom of the side groove on each side. Since crack front irregularities may make it difficult to determine the crack length at the specified locations, it is suggested that the measurement be taken as a visual average across a strip of width, $B_N/4$, centered at each measurement location. Examples of sample crack size determinations using this technique are also provided in Annex A1.

NOTE 7—It is recommended that a photographic record of the heat-tinted fracture surface be made a part of the test report, particularly if there are any unusual perturbations in the crack front contours. Descriptive comments may also be helpful.

9. Calculation and Interpretation of Results

9.1 Displacement Measurement:

9.1.1 From the autographic force-displacement record, several displacement values should be determined. Fig. 8 is a typical force-displacement record for a specimen tested using

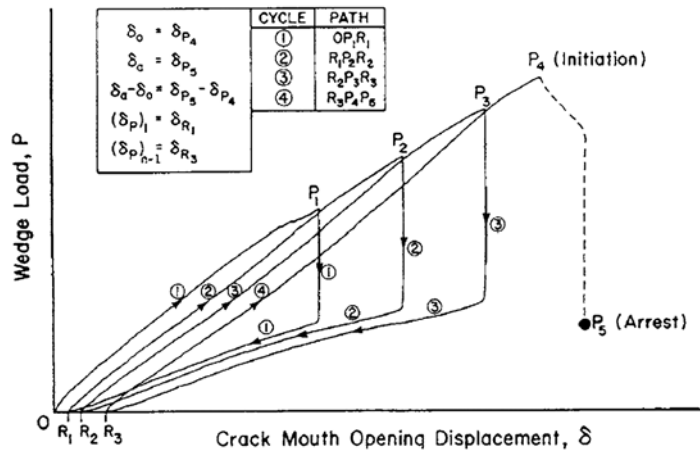


FIG. 8 Wedge-Force Versus Crack-Mouth-Opening-Displacement Record for a Specimen Tested Using Cyclic Loading Techniques, that Displayed Rapid Run-Arrest Fracturing on the Fourth Loading Cycle

TABLE 1 Values of $f(x)$ for use in (Eq 4)

x	$f(x)$	x	$f(x)$	x	$f(x)$
0.20	0.390	0.42	0.223	0.64	0.149
0.21	0.378	0.43	0.218	0.65	0.147
0.22	0.367	0.44	0.214	0.66	0.144
0.23	0.357	0.45	0.210	0.67	0.141
0.24	0.347	0.46	0.206	0.68	0.139
0.25	0.337	0.47	0.202	0.69	0.136
0.26	0.328	0.48	0.198	0.70	0.133
0.27	0.319	0.49	0.194	0.71	0.131
0.28	0.310	0.50	0.191	0.72	0.128
0.29	0.302	0.51	0.188	0.73	0.125
0.30	0.294	0.52	0.184	0.74	0.122
0.31	0.287	0.53	0.181	0.75	0.119
0.32	0.280	0.54	0.178	0.76	0.117
0.33	0.273	0.55	0.175	0.77	0.114
0.34	0.266	0.56	0.172	0.78	0.111
0.35	0.260	0.57	0.169	0.79	0.108
0.36	0.254	0.58	0.166	0.80	0.105
0.37	0.248	0.59	0.163	0.81	0.102
0.38	0.243	0.60	0.160	0.82	0.098
0.39	0.237	0.61	0.158	0.83	0.095
0.40	0.232	0.62	0.155	0.84	0.092
0.41	0.227	0.63	0.152	0.85	0.088

sequential load-unload cycling that did not exhibit unstable cracking until the fourth loading cycle. The required displacements are as follows:

- 9.1.1.1 $(\delta_p)_1$ = displacement offset at the end of the first load cycle = δ_{R1} in Fig. 8;
- 9.1.1.2 $(\delta_p)_{n-1}$ = total displacement offset at the end of the $(n - 1)$ cycle = total displacement offset at the start of the last cycle = δ_{R3} in Fig. 8;
- 9.1.1.3 δ_o = displacement at the onset of unstable crack growth = δ_{P4} in Fig. 8;
- 9.1.1.4 δ_a = displacement approximately 0.1 s after crack arrest = δ_{P5} in Fig. 8;
- 9.1.1.5 $\delta_a - \delta_o$ = rapid increase in crack opening that frequently accompanies the run-arrest event = $\delta_{P5} - \delta_{P4}$ in Fig. 8.

NOTE 8—The preferred interpretation of δ_a is the opening displacement at about 2 ms after crack arrest. However, this measurement may not be possible with the instrumentation used. This testing practice assumes that δ_a at about 100 ms after crack arrest does not differ significantly from δ_a at 2 ms.

9.1.2 In the brittle weld CCA specimen, a force drop of 50 to 60 % has been found to indicate that a sufficient length of unstable fracture has occurred and that δ_a is a usable arrest displacement value. See 9.3.2 and 9.3.4 for limitations on the length of the run-arrest segment.

9.2 Calculation of K_o and K_{Qa} :

9.2.1 Calculate K_o and K_{Qa} from the following:

$$K = E \delta f(x) \frac{\sqrt{B/B_N}}{\sqrt{W}} \text{ MPa}\sqrt{\text{m}} \text{ (ksi}\sqrt{\text{in.}}) \quad (4)$$

where:

$$f(x) = (1 - x)^{0.5} (0.748 - 2.176x + 3.56x^2 - 2.55x^3 + 0.62x^4) \text{ and} \quad (5)$$

$$x = a/W.$$

9.2.2 The expression for $f(x)$ used here is based on a curve fit to boundary value collocation results and an exact limit solution (10). The curve fit is considered to be accurate within 1 % over the range $0.20 \leq x \leq 1$, and is in close agreement with experimental compliance results (11). Values of $f(x)$ computed from (Eq 5) for various values of x are given in Table 1. The other terms in (Eq 4) are as follows:

- E = Young's modulus, MPa (ksi),
- a = initial slot size, a_o , or final crack size, a_a , as determined in 8.6, m (in.),
- W = specimen width, m (in.),
- B = specimen thickness as shown in Fig. 5, m (in.),
- B_N = specimen thickness at crack plane as shown in Fig. 5, m (in.), and
- δ = crack mouth opening displacement, m (in.).

9.2.3 To calculate K_o , use $a = a_o$ and $\delta = d_o$. To calculate K_{Qa} , use $a = a_a$ and $\delta = d_a$. The quantities d_o and d_a are given as follows:

$$d_o = \delta_o - (\delta_p)_{n-1}, \text{ and} \quad (6)$$

$$d_a = \delta_o - (\delta_p)_1 - 0.5[(\delta_p)_{n-1} - (\delta_p)_1] + 0.5[\delta_a - \delta_o] \quad (7)$$

$$= 0.5[\delta_o + \delta_a - (\delta_p)_1 - (\delta_p)_{n-1}] \quad (8)$$

NOTE 9—The quantities in brackets in (Eq 7) both represent displacement components whose exact contribution to the energy available to drive the running crack is unclear at the present time. The rationale for the

selection of the premultiplier of 0.5 for each of these quantities is discussed in Ref (2). (Eq 8) is simply a mathematical simplification of (Eq 7) and may be more convenient to use from a computational standpoint.

NOTE 10—If a rapid run-arrest event occurs on the first loading cycle, (Eq 8) should be used with $(\delta_p)_{n-1}$ and $(\delta_p)_1$ set equal to zero.

9.3 Validity Requirements:

9.3.1 The value of K_{Qa} calculated from (Eq 4) can be considered a linear-elastic plane-strain value, K_{Ia} , provided the criteria described in 9.3.2-9.3.4 and summarized in Table 2 are satisfied. Comments on the adequacy of these requirements can be found in Refs (2) and (12). It should also be pointed out that in some instances, the extrapolation of a combined set of test results, including some which would be deemed invalid by these criteria, may be useful in predicting the behavior of large structures.

9.3.1.1 Use is made in the following of σ_{Yd} , a formal dynamic yield strength estimate for appropriate loading times at the test temperature. For structural steels, it is being assumed here that σ_{Yd} is 205 MPa (30 ksi) greater than the yield strength, σ_{YS} , measured by Test Methods E8.

NOTE 11—The extremely high strain rates associated with yielding near the tip of a fast running crack and the abrupt nature of crack arrest suggest that the true elevation of σ_{Yd} over σ_{YS} should be much greater. The value of σ_{Yd} that is being used here is therefore thought to substantially underestimate the actual effective resistance to plastic flow at crack arrest (12).

9.3.2 The unbroken ligament, $W - a_a$, must equal or exceed both $0.15W$ and $1.25 (K_{Qa}/\sigma_{Yd})^2$.

9.3.3 The thickness, B , must equal or exceed $1.0 (K_{Qa}/\sigma_{Yd})^2$.

9.3.4 The minimum crack jump, $a_a - a_o$, must be at least twice the slot width, N , defined in Fig. 5, and greater than the plane-stress plastic zone radius associated with the initial loading, $(K_o/\sigma_{YS})^2/2\pi$.

NOTE 12—If a duplex specimen is used, the alternative requirement is that the crack penetrate a distance equal to or greater than B_N into the test section.

10. Report

10.1 Report the following information:

10.1.1 Test Identification:

10.1.1.1 Date,

10.1.1.2 Specimen number, and

10.1.1.3 Crack plane orientation in accordance with Terminology E1823.

10.1.2 Material:

10.1.2.1 Material type,

10.1.2.2 Young's modulus,

10.1.2.3 Yield strength (offset – 0.2 %) as determined by Test Methods E8, and

10.1.2.4 Dynamic yield strength used in 9.3.2 and 9.3.3.

10.1.3 Test Temperature:

10.1.4 Starter Notch:

10.1.4.1 Type of brittle weld, if any,

10.1.4.2 Notch width, N , and

10.1.4.3 Notch root radius, ρ .

10.1.5 Specimen Dimensions:

10.1.5.1 Specimen thickness, B ,

10.1.5.2 Specimen thickness at crack plane, B_N ,

10.1.5.3 Thickness ratio, B_N/B , and

10.1.5.4 Width, W .

10.1.6 Crack Size Measurements:

10.1.6.1 Method used for marking the arrested crack front,

10.1.6.2 Crack size at machined notch, a_o , and

10.1.6.3 Crack size at arrest,

(1) At mid-thickness, a_2 ,

(2) At $1/4$ points of net thickness, a_1 and a_3 , and

(3) Average crack size at arrest, $a_a = (a_1 + a_2 + a_3)/3$.

10.1.7 Test Record:

10.1.7.1 Force and displacement records and associated calculations,

10.1.7.2 First cycle limiting displacement, $[(\delta_o)_1]_{\max}$,

10.1.7.3 Opening displacement increment for subsequent cycles, $(\delta_o)_{\text{inc}} = 0.25 [(\delta_o)_1]_{\max}$,

10.1.7.4 Number of load/unload cycles, n ,

10.1.7.5 Displacements measured from force-displacement records,

(1) Displacement offset at end of first loading cycle, $(\delta_p)_1$,

(2) Total displacement offset accumulated prior to start of last loading cycle, $(\delta_p)_{n-1}$,

(3) Displacement at onset of unstable crack growth, δ_o ,

(4) Displacement at crack arrest, δ_a , and

(5) Displacement increase accompanying the run-arrest event, $\delta_a - \delta_o$,

10.1.7.6 Displacements used to calculate K_o and K_{Qa} ,

(1) Displacement used to calculate K_o , d_o according to Eq 6

(2) Displacement used to calculate K_a , d_o according to Eq 7 or Eq 8.

10.1.7.7 Force drop as a percentage of $P_{\max}$.

10.1.8 Calculated Values of K_o and K_{Qa} (K_{Ia}):

10.1.8.1 K_o , and

10.1.8.2 K_{Qa} (K_{Ia}).

10.1.9 Validity Requirements (see Table 2):

10.1.9.1 Uncracked ligament length,

(1) Compared to $0.15W$, and

(2) Compared to $1.25 (K_{Qa}/\sigma_{Yd})^2$,

10.1.9.2 Thickness, compared to $1.0 (K_{Qa}/\sigma_{Yd})^2$,

10.1.9.3 Crack jump length,

(1) Compared to $2N$, and

(2) Compared to $(K_o/\sigma_{YS})^2/2\pi$.

10.1.10 Photographic Record of Fracture Surfaces and Descriptive Comments (Optional):

11. Precision and Bias

11.1 Precision:

11.1.1 The precision of a K_{Ia} determination by this test method is a function of the precision and bias of the various measurements of linear dimensions of the specimen and testing fixtures, the precision of the displacement measurements, the

TABLE 2 Summary of Criteria Used to Ensure That K_{Qa} is a Linear Elastic, Plane-Strain Value

Feature	Criterion
Unbroken ligament	(A) $W - a_a \geq 0.15W$
Unbroken ligament	(B) $W - a_a \geq 1.25 (K_a/\sigma_{Yd})^2$
Thickness	(C) $B \geq 1.0 (K_a/\sigma_{Yd})^2$
Crack-jump length	(D) $a_a - a_o \geq 2N$
Crack-jump length	(E) $a_a - a_o \geq (K_o/\sigma_{YS})^2/2\pi$

precision and bias of the recording devices used to produce the force displacement record, and the precision and bias of the measurements of the arrested crack size. It is not possible to make meaningful statements concerning precision and bias for all of these measurements. However, it is possible to derive useful information concerning the precision of a K_{Ia} measurement in a global sense from the results of an interlaboratory round-robin test program that was conducted to evaluate the originally proposed test method on which this test method is based (2).⁵

11.1.2 The results from this program are summarized in Table 3. It should be appreciated that the measures of precision shown in Table 3 apply to tests conducted with materials that exhibit strong transitional behavior in terms of temperature. A larger degree of scatter in K_{Ia} measurements could therefore be expected in tests conducted higher in the transition range, although the coefficient of variation appears to be temperature insensitive for some materials (6). The materials tested also exhibit significant inhomogeneity, and a size effect may be apparent when testing specimens of different sizes, with tests

⁵ Information on K_{Ia} round-robin data and the round-robin program is available in Ref (2), a copy of which is available from ASTM Headquarters. Request RR:E8-1003.

TABLE 3 Grand Means and Standard Deviations for K_{Ia} for Three Steels as Obtained From a Large Interlaboratory Round Robin Test Program^A

Material Tested	A514 ^B	A588 ^C	A533B ^D	A533B ^D
Test Temperature	–30°C	–30°C	10°C	25°C
No. of Test Results	12	40	30	28
Mean K_{Ia} , MPa $\sqrt{m}$	88.4	61.5	78.2	83.4
Standard Deviation, MPa $\sqrt{m}$ and percent	10.2 (12 %)	6.4 (10 %)	9.7 (12 %)	10.6 (13 %)

^A A total of 21 laboratories reported test results from the program.

^B Specimens were cut from 50.8 mm (2-in.) thick rolled plate and tested full thickness in an L-T orientation; σ_{YS} = 890 MPa (129 ksi); NDT = –50°C (–58°F); RT_{NDT} = –12°C (10°F).

^C Specimens were cut from 50.8-mm (2-in.) thick rolled plate and tested full thickness in an L-T orientation; σ_{YS} = 330 MPa (48 ksi); NDT = –10°C (14°F); RT_{NDT} = –9°C (16°F).

^D Specimens of 50.8-mm (2-in.) thickness were cut from 254mm (10-in.) thick rolled plate and tested in an L-S orientation; σ_{YS} = 480 MPa (70 ksi); NDT = –12°C (10°F); RT_{NDT} = –2°C (28°F).

on smaller specimens being characterized by larger scatter than tests on larger specimens.

11.2 *Bias*—There is no accepted standard value for the plane-strain crack-arrest fracture toughness of any material. In the absence of such a true value, any statement concerning bias is not meaningful.

ANNEX

(Mandatory Information)

A1. GUIDELINES FOR ASSESSING FRACTURE SURFACE ACCEPTABILITY AND PROCEDURES FOR DETERMINING THE ARRESTED CRACK SIZE

A1.1 Introduction:

A1.1.1 The idealized fracture surface of a crack arrest specimen is flat, continuous, and straight-fronted. This idealization can be closely approached in practice, as evidenced by Fig. A1.1 and Fig. A1.2. However, the fracture surfaces of crack-arrest specimens can be complicated by features that, when present in excess, can lead to questionable results for the crack-arrest fracture toughness of the material being tested. This annex provides guidelines for identifying, from the fracture surface appearance, test results that are probably not representative of the bulk of the material being tested. It also provides guidelines for determining the arrested crack size, a_a , for a specimen with an irregular crack front.

A1.1.2 Deviations from the ideal fracture surface appearance generally fall into three broad categories. These are: the presence of remaining ligaments, a lack of crack front straightness, and crack propagation out of the plane of the side grooves. The extent to which one or more of these behaviors can occur without adversely affecting the test result cannot be easily quantified at the present time. The purpose of this annex is to provide a basis for the decision-making process that is required in assessing fracture surface acceptability and it is

intended to serve as a set of guidelines for the personnel involved in obtaining crack-arrest toughness data.

A1.1.3 The final decision as to which fracture surfaces will be classified as unacceptable presently rests primarily on the judgment of the individual (or individuals) performing and evaluating the test. This judgement should be based on experience, or on some knowledge of what is representative for the particular steel and test temperature combination under consideration. Judgmental decisions of this nature are clearly undesirable from a standards viewpoint. However, the alternative would be to disregard test results from all specimens with any degree of fracture surface irregularity. This would not only reduce the percentage of successful, valid tests to a very small number, but would also eliminate virtually all tests performed under certain conditions, for example, at temperatures well into the transition range for a given material. As the testing technology involved here matures, it is anticipated that this annex will be updated to a more quantitative level.

A1.2 Fracture Surface Acceptability:

A1.2.1 Remaining Ligaments:

A1.2.1.1 In a number of steels, portions of the surface formed by a rapid fracture frequently remain unbroken. These

unbroken regions, termed ligaments, are more frequently observed at higher temperatures and higher toughness levels. These unbroken ligaments have been observed in large structural tests as well as in the laboratory-sized specimens employed by this test method (2, 5, 6). Since ligaments are commonly observed, their presence on the fracture surfaces of crack arrest specimens tested in the laboratory using this test method may be representative of the fracture of a structural member fabricated from the test material, in service at the test temperature.

A1.2.1.2 In the transition temperature range, ligation of the fracture surface is due to connections between noncoplanar regions of cleavage, which subsequently break by hole-joining. However, the strain required for their fracture may not occur prior to crack arrest and the result is a ligamented fracture surface. These ligaments are often undercut and do not always exert excessive closing forces. The degree of influence of remaining ligaments on the running crack is uncertain. However, their tendency to produce an earlier crack arrest position (and consequently, a larger K_{Ia}) might be greater in a moderate-sized laboratory test specimen than for a large crack in a service component.

A1.2.1.3 In assessing the influence of remaining ligaments on the fracture behavior of a CCA specimen tested using this test method, it is necessary to distinguish between the presence of a number of remaining ligaments distributed over the entire fracture surface and one or more large ligaments that may sometimes be present. Specimens that display excessively large remaining ligaments should be disregarded when using this test method. Two examples of single, large unbroken ligaments (the light areas on the heat-tinted fracture surfaces) are shown in Fig. A1.3 and Fig. A1.4. In both cases, the test results obtained from these specimens were high in comparison to other test results for the same steels tested under the same conditions (2).

A1.2.1.4 When distributed ligaments are present, the total area of the remaining ligaments may be so large as to give a nonrepresentative value of K_{Ia} . The only method of evaluating whether the degree of remaining ligaments on a given specimen is truly representative of the material behavior at the test temperature of interest, is to perform a large number of tests under identical conditions, thereby establishing a baseline for observations. By comparing the results of an individual specimen with the baseline data set, it can be more easily determined if the appearance of the fracture surface is associated with an atypical test result. If it is impractical to perform enough tests to establish a baseline, it is difficult to determine if the degree of ligation on a particular specimen is actually representative of the test material/temperature combination. As a rough guideline, few or no remaining ligaments are expected at temperatures below the ductile to brittle transition temperature of the steel being tested. (The transition temperature being referred to here would be a temperature such as the drop-weight nil ductility temperature determined using Test Method E208 or the temperature of the lower portion of the transition of the Charpy impact energy versus temperature curve determined using Methods E23.) As the test temperature increases to the limit at which a rapid fracture can be initiated

using the brittle-weld CCA specimen described in this test method (typically from 30 to 40°C (55 to 70°F) above the dropweight NDT) the portion of the fracture surface composed of remaining unbroken ligaments may approach 50 % and still give acceptable results for K_{Ia} . For the purposes of this test method, 50 % will be taken as the upper limit on the area of the fracture surface that can be covered by the remaining ligaments before the test result is disregarded.

A1.2.1.5 Examples of CCA specimen fracture surfaces displaying varying degrees of distributed remaining ligaments are shown in Fig. A1.5, Fig. A1.6, and Fig. A1.7. The extent of ligation in Fig. A1.5 is small. Fig. A1.6 shows a more strongly ligamented fracture surface, but the degree of ligation is not severe enough to justify discarding the data. The fracture surface shown in Fig. A1.7 borders on the limits of what could be considered acceptable and its retention would have to be justified through comparison with a baseline data set as discussed in A1.2.1.4.

A1.2.2 Lack of Crack-Front Straightness:

A1.2.2.1 Nonideal behaviors that fall into this classification can be divided into two areas: slanted crack fronts and crack-front curvature (or tunneling).

A1.2.2.2 Slanted crack fronts by themselves are not generally considered to be a problem in crack-arrest testing as long as they are not extreme. Specimens with crack fronts inclined at angles of up to 45° from the side of the specimen have been seen to produce results that agree well with large data sets (2), see for example Fig. A1.8 and Fig. A1.9. Results from specimens for which the angle of the crack front exceeds 45° should be disregarded. (In testing CCA specimens, consistently slanted crack fronts can be caused by improper machining, alignment, lubrication, or seating of the load train, specimen, and support block. These should all be checked and corrected if necessary.)

A1.2.2.3 Excessive crack front curvature is another reason to discard a test result on the basis of the appearance of the fracture surface. The major problem occurs when the crack propagates only in the center of the specimen (tunnels) and leaves substantial unbroken ligaments at the edges of the fracture surface, but the crack plane remains within the plane of the side grooves, that is, still within the net specimen thickness, B_N . (The situation in which the crack tunnels and propagates out of the plane of the side grooves is a separate case and is discussed in A1.2.3.) Such behavior, when it occurs to a limited extent, does not seem to significantly affect the value of the crack arrest toughness calculated for the specimen, in the same sense as a limited degree of ligation distributed over the bulk of the fracture surface does not affect the test result. The principal concern with this type of behavior is that, when it is present to a significant degree, it is not representative of the fracture of a structure and is caused by the lower triaxial constraint that exists near the edges of the crack plane even at the base of the side grooves. Specimens with excessive tunneling in which substantial amounts of the edges of the fracture surface remain unbroken have been found to produce abnormally high values of arrest toughness and should be disregarded (2).

A1.2.2.4 Fig. A1.10 and Fig. A1.11 show two examples of cracks that have tunneled but for which the crack plane has remained within the plane of the side grooves. The fracture surface shown in Fig. A1.10 would be acceptable, while the example shown in Fig. A1.11 would not.

A1.2.3 Out-of-Plane Crack Propagation:

A1.2.3.1 Test results should also be disregarded if the plane of crack propagation either makes an angle greater than 10° with the plane of the side grooves or if the crack plane lies entirely outside the midplane of the specimen.

A1.2.3.2 In cases where the crack moves only slightly out of the midplane and the portion that is outside the net thickness of the specimen does not fracture during the run-arrest event, a fracture surface is produced that appears tunneled, as for example in Fig. A1.12 and Fig. A1.13. Such behavior is not generally considered to be a problem from the standpoint of either tunneling or out-of-plane propagation since the unbroken ligaments at the edges of the fracture surface forming the tunnel are not restrained by the material that was removed to form the side grooves. They are consequently able to bend during the run-arrest event, thus allowing it to progress more or less normally.

A1.2.3.3 In the extreme situation, when the crack has moved almost entirely out of the side groove into the gross thickness of the plate, the test result should be discarded, regardless of whether or not the portion of the fracture surface outside the net thickness has fractured. Examples of fracture surfaces that would be unacceptable for this reason are shown in Fig. A1.14 and Fig. A1.15.

A1.3 Determination of the Arrested Crack Size, a_a :

A1.3.1 As described in 8.6 of this test method, the arrested crack size, a_a , is taken to be the average of three measurements made on the heat-tinted fracture surface of the specimen. These measurements are to be made at the center of the specimen ($B_N/2$) and halfway between the center of the specimen and the edge of the side groove, on each side ($B_N/2 \pm B_N/4$). It is further stated that, at each measurement location, the measurement should be taken as a visual average of the position of the crack front across a strip of width $B_N/4$, centered at the measurement location.

A1.3.2 The visual average is specified to avoid taking a measurement at a point that may not accurately represent the local average position of the crack front in the vicinity of the measurement location. For purposes of analysis, it is assumed that the crack front is both straight and smooth. The visual averaging technique is intended to provide a crack tip location with locally as much unbroken material ahead of it as there is broken material behind it, when averaged across the width of the measurement strip. The visual averaging technique may thus provide some degree of conservatism, since the calculated stress intensity factor decreases as the crack size increases in the calculational procedure employed in this test method.

A1.3.3 Examples of local irregularities in arrested crack fronts can be readily seen in Figs. A1.1-A1.15, which have been presented previously. Three examples of arrested crack size determinations for different degrees of measurement complexity are shown in Figs. A1.16-A1.18. In each case, strips of width $B_N/4$ are shown, each centered on one of the

three lines along which the crack size determinations are to be made. A visual average of the position of the crack front has then been taken within each individual strip. The distance of each of the three visually averaged crack front locations from the center of the specimen loading hole has also been indicated. The resulting three measurements are then averaged to calculate the arrested crack size, a_a , for use in subsequent calculations.

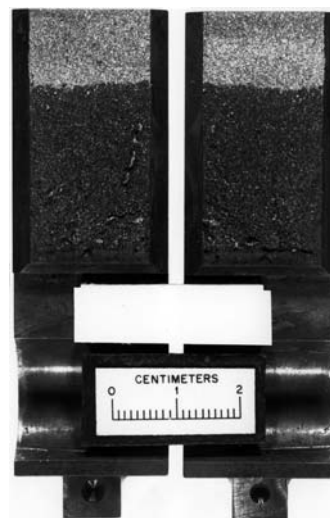


FIG. A1.1 An Example of an Ideal Fracture Surface of a CCA Specimen



FIG. A1.2 Another Example of an Ideal Fracture Surface of a CCA Specimen

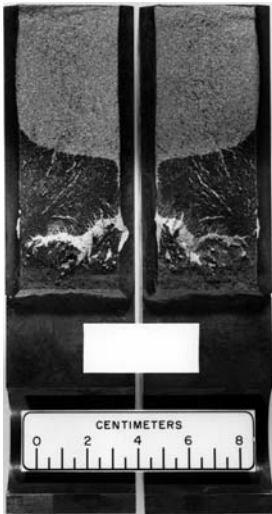


FIG. A1.3 Fracture Surface of a CCA Specimen Showing a Large, Transverse Remaining Ligament

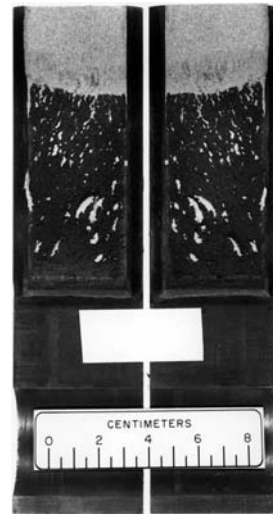


FIG. A1.5 Fracture Surface of a CCA Specimen Showing Very Few Remaining Ligaments

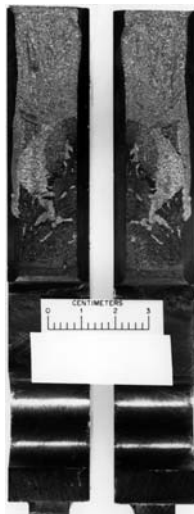


FIG. A1.4 Fracture Surface of a CCA Specimen Showing a Large Remaining Ligament Aligned with the Direction of Crack Propagation

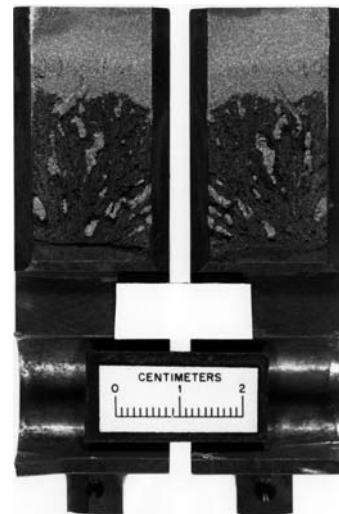


FIG. A1.6 Fracture Surface of a CCA Specimen Showing a Moderate Degree of Ligamentation

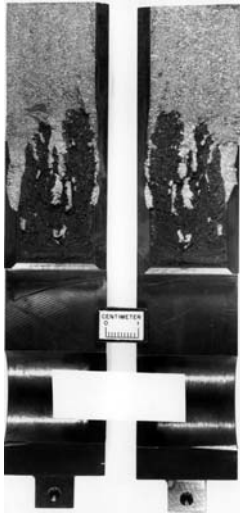


FIG. A1.7 Fracture Surface of a CCA Specimen Showing Extensive Ligamentation

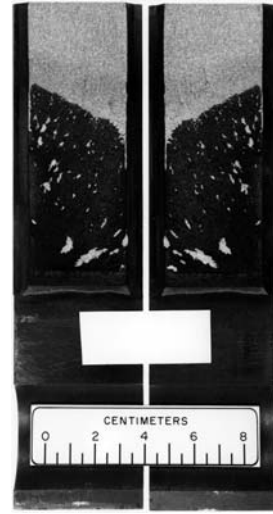


FIG. A1.9 Fracture Surface of a CCA Specimen with a Slanted and Nearly Straight Crack Front



FIG. A1.8 Fracture Surface of a CCA Specimen with a Slanted and Straight Crack Front



FIG. A1.10 Fracture Surface of a CCA Specimen with a Tunneled but Acceptable Crack Front



FIG. A1.11 Fracture Surface of a CCA Specimen with an Unacceptably Tunneled Crack Front



FIG. A1.13 Fracture Surface of a CCA Specimen for Which the Crack has Grown Out of the Midplane of the Specimen but has Remained Mostly Within the Net Specimen Thickness, B_N

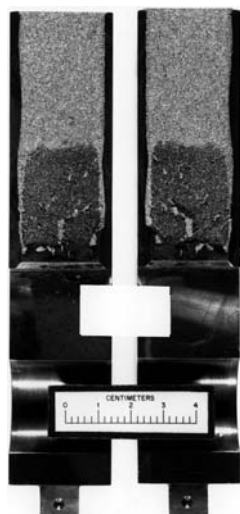


FIG. A1.12 Fracture Surface of a CCA Specimen for Which the Crack has Started to Grow Out of the Midplane of the Specimen but has Remained Within the Net Specimen Thickness, B_N

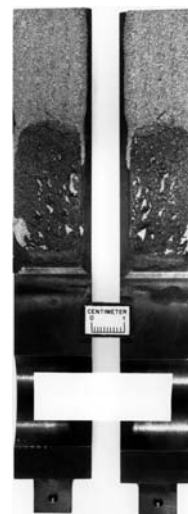


FIG. A1.14 Fracture Surface of a CCA Specimen for Which the Crack has Grown Out of the Midplane of the Specimen and Broken Through the Gross Thickness of the Specimen on One Side

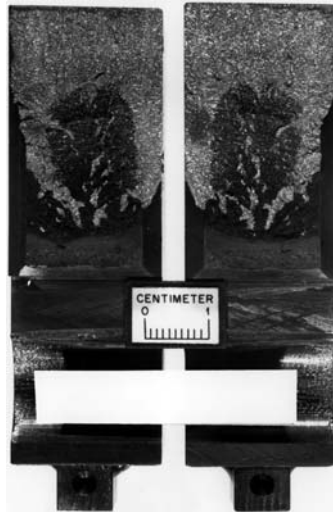


FIG. A1.15 Fracture Surface of a CCA Specimen for Which the Crack has Tunneled and Run Out of the Midplane of the Specimen as Well as Almost Entirely Out of the Side Grooved Section

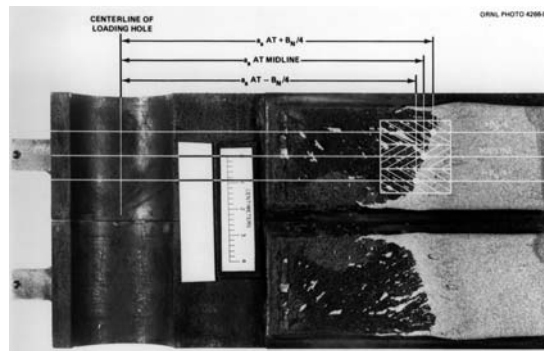


FIG. A1.16 Example of Arrested Crack Size Determination for a CCA Specimen with a Slanted Crack Front and a Small Amount of Ligamentation on the Fracture Surface

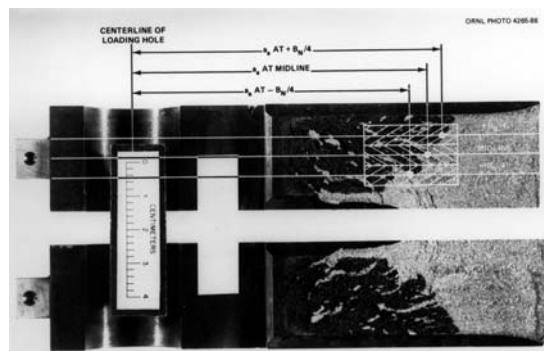


FIG. A1.17 Example of Arrested Crack Size Determination for a CCA Specimen with an Irregular and Slanted Crack Front and a Moderate Degree of Ligamentation

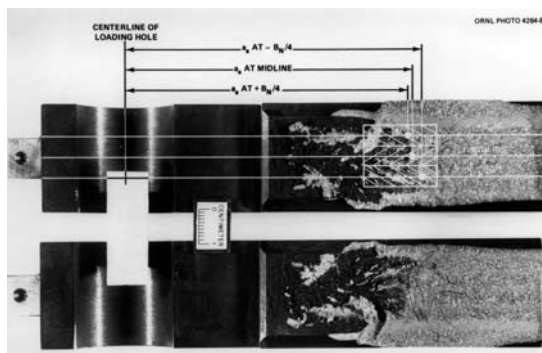


FIG. A1.18 Example of Arrested Crack Size Determination for a CCA Specimen with a Highly Irregular Crack Front and a Heavily Ligamented Fracture Surface

APPENDIXES

(Nonmandatory Information)

X1. GUIDELINES ON STARTER NOTCH PREPARATION TECHNIQUES

X1.1 The preparation of the specimen starter notch is one of the most difficult parts of the overall fabrication of the test specimen and can require considerable developmental work and acquisition of expertise on the part of the user of this test method. It is up to the user to ensure that the techniques adopted for starter notch preparation achieve the desired result; namely, to initiate a fast running segment of flat-tensile separation that will propagate into the test section and extend beyond any heat-affected zone or plastically deformed region that may be developed in the vicinity of the starter notch.

X1.1.1 A welding procedure similar to that described in Test Method E208 has been found satisfactory, with some modification, for starter notch preparation of brittle-weld CCA specimens. The major differences are due to the former having a flat surface, while the latter has a radiused slot. As in Test Method E208, the brittle zone that is created at the tip of the starter notch should not play any role beyond that of initiating a fast-running crack.

X1.1.2 The technique requires a crack starter notch of sufficient width for the electrode to reach the bottom of the slot. The notch can be fabricated by drilling a hole with its center at the desired location of a_o , with the sides of the notch being produced by saw cutting to the hole. Weld starter and runout blocks are used. The finished single-pass weld should have a relatively flat surface to facilitate subsequent notching. Experience has shown that introduction of a brittle weld does not introduce serious distortion. A light surface grind operation may, however, be necessary. A notch is machined in the weld as shown in Fig. 6. A notch root radius, ρ , of 0.25 to 0.38 mm (0.010 to 0.015 in.) or even larger can be used.

X1.1.3 Certain electrodes, such as the types historically used in Test Method E208, have been found to perform satisfactorily for this application, also. This type of electrode includes, but is not limited to, Boehler's Foxdur 350 or 500 electrodes (2). Unfortunately, the electrode currently recommended for Test Method E208, McKay DWT, has been observed to be somewhat less than satisfactory for CCA

specimens. Another electrode that has been used successfully is Boehler UTP DUR 400. Other hard-facing electrodes may also prove satisfactory.⁶ For welders having little experience with the recommended electrodes, it is recommended that several practice beads be laid, first on a flat surface and then on a slotted sample, with slots similar to those used in the test specimen. Embrittling the notch root by autogenous welding procedures such as TIG or EB welding has also proven to be successful.

X1.1.4 Crack starter weld beads of Foxdur 350 or 500 have been deposited successfully in steel crack-arrest specimens in the following manner:

X1.1.4.1 Preheat the specimen to 100°C (210°F);

X1.1.4.2 Use DC, plus terminal on electrode;

X1.1.4.3 Use a short arc length;

X1.1.4.4 Use a welding current of 180 to 230 A for electrodes 5 mm in diameter, or a welding current of 140 to 180 A for electrodes 4 mm in diameter;

X1.1.4.5 Use a welding speed of approximately 100 mm/min (4 in./min);

X1.1.4.6 Use starter tabs and runout tabs, approximately 13 mm (0.5 in.) thick and 25 mm (1.0 in.) square;

X1.1.4.7 Complete the weld in one pass; and

X1.1.4.8 Weld with a slight weaving motion of the electrode.

X1.1.4.9 Drying of the electrodes for 2 h at 250 to 350°C (450 to 650°F) is recommended. Other electrodes may or may not require drying. In general, similar welding procedures may be used with other hard-facing-type electrodes.

X1.1.5 The appearance of cracks in the weld bead does not necessarily indicate that the bead will not perform satisfactorily as a crack starter. The introduction of a notch into the weld bead may remove the cracks. However, even if the notching

⁶ The following equipment, as listed in RR:E8-1003, was used to develop the precision statement: (Boehler's Foxdur 350 or 500). This listing is not an endorsement or certification by ASTM International.

operation does not remove the weld cracks, rapidly propagating cracks have been initiated successfully in many instances from cracked weld beads. In fact, it has been observed frequently that initially sound brittle welds develop cracks visible to the naked eye under load, well before initiation of an unstable crack. This is presumably because it is primarily the hardened portion of the heat-affected zone beneath the weld bead that controls the initiation of the desired event, rather than the notched weld bead itself. The decision as to whether a cracked weld bead is likely to perform as desired is largely a matter of experience and judgment. Specimens containing defective welds can be rewelded after the previously deposited fusion zone has been removed by machining. There is a possibility that cracks may appear in the heat-affected zone of the specimen. Preheating of the specimens may therefore be necessary. A temperature of 210°C (100°F) when using the Foxdur 350 or 500 has been found to be helpful.

X1.2 Techniques other than the use of the brittle weld-bead crack-starting method are acceptable means of initiating a fast-running crack in ferritic materials. Many other methods have been used successfully by various investigators and some of these are described in X1.2.1-X1.2.3.

X1.2.1 In the quenched-chevron method, the specimen notch region is prepared in a manner similar to that used in the chevron-notched specimen described in Test Method E1304. The specimen is set up vertically in a water bath with the tip of the chevron above the water. The apex of the chevron is then heated using a welding torch until the metal at the tip of the chevron is about to melt, at which point the specimen is tipped

over into the water. This introduces an embrittled region at the tip of the chevron notch which may then initiate the rapid run-arrest event desired.

X1.2.2 In the electric discharge current method, a high-amperage discharge welding device, such as a stud welder, is applied across the thickness of a CCA specimen at the point where the desired crack tip will be located. This creates a self-quenched, embrittled region in the specimen, and a notch is subsequently machined into the embrittled region to serve as a crack initiator (15).

X1.2.3 It is sometimes useful to use a blunted fatigue notch to obtain additional control over the level of K_{Ia} at which the run-arrest event initiates, particularly when testing at temperatures low enough to result in relatively low values of K_{Ia} in the material being tested. In this test method, the specimen is fatigue precracked, using additional holes machined along the load line, well away from the edge of the central, split-pin loading hole. The tip of the fatigue crack is then blunted by loading the specimen to a level in excess of that desired for the initiation of the desired run-arrest event, but at a temperature high enough to preclude brittle crack initiation. In essence, this is warm prestressing of the fatigue cracked CCA specimen. In subsequent crack-arrest testing, the specimen will often exhibit crack initiation at levels of K_{Ia} that are above the typical brittle fracture toughness level of the material but less than that imposed during the warm prestress cycle. This test method can be helpful in achieving K_{Ia} values that are high enough to obtain a run-arrest event but low enough that the arrest event occurs within the central portion of the CCA specimen (16).

X2. DETERMINATION OF CRACK ARREST TOUGHNESS REFERENCE TEMPERATURE, $T_{K_{Ia}}$

X2.1 Scope

X2.1.1 This appendix describes the method for determining $T_{K_{Ia}}$ for ferritic steels. The value $T_{K_{Ia}}$ is the crack arrest toughness master curve reference temperature. The crack arrest master curve describes a common temperature dependence of crack arrest toughness for ferritic steels. The temperature dependence of the median crack arrest fracture toughness, $K_{Ia(med)}$, is given by:

$$K_{Ia(med)} = 30 + 70 \exp [0.019 (T - T_{K_{Ia}})] \quad (X2.1)$$

where $T_{K_{Ia}}$ is the temperature (°C) corresponding to a median crack arrest toughness value of 100 MPa√m.

X2.1.2 An individual crack arrest fracture toughness test which does not result in a valid K_{Ia} crack arrest fracture toughness value can represent a censored result which is not accounted for in the calculation procedures of this appendix. As a result, the value of $T_{K_{Ia}}$ determined in accordance with the procedures in this appendix may be biased with respect to the true $T_{K_{Ia}}$, especially if the invalid data are not uniformly distributed within the crack arrest fracture toughness distribution.

X2.2 Terminology

X2.2.1 *crack arrest reference temperature, $T_{K_{Ia}}$ [°C]*—The test temperature at which the median of the K_{Ia} distribution will equal 100 MPa√m (91.0 ksi√in.).

X2.3 Calculation

X2.3.1 The reference temperature, $T_{K_{Ia}}$, should be relatively independent of the test temperature range that has been selected. Hence, data that are distributed over a restricted temperature range, namely $T_{K_{Ia}} \pm 50^\circ\text{C}$, can be used to determine $T_{K_{Ia}}$. A minimum of 6 valid K_{Ia} values or the equivalence, by weight factor, described below is required. In the case of data generated at test temperatures from 10°C below $T_{K_{Ia}}$ to 50°C above $T_{K_{Ia}}$, the minimum requirement of 6 valid values will be satisfactory.

X2.3.2 Data generated at test temperatures in the range of $T_{K_{Ia}} - 50^\circ\text{C}$ to $T_{K_{Ia}} + 10^\circ\text{C}$ are considered to make reduced accuracy contribution to $T_{K_{Ia}}$ determinations. As a consequence, more data development within the aforementioned temperature range is required. The following weighting system specifies the required number of data:

$$\sum_{i=1}^6 r_i n \geq 1 \quad (\text{X2.2})$$

where r_i is the number of valid specimens within the i -th temperature range, $(T - T_{KLa})$, and n_i is the specimen weighting factor for the same temperature range as shown in **Table X2.1**.

X2.3.3 Maximum likelihood method for determining provisional T_{KLaQ}

Use all valid crack arrest data to determine T_{KLaQ} by iteratively solving the equation Eq X2.3 for $T_{KLa(i)Q}$:

$$\sum_{i=1}^n \frac{\ln K_{La(i)} \times \exp [0.019 (T_i - T_{KLaQ})]}{30 + 70 \exp [0.019 (T_i - T_{KLaQ})]} - \sum_{i=1}^n \frac{\ln \{30 + 70 [0.019 (T_i - T_{KLaQ})]\} \times \exp [0.019 (T_i - T_{KLaQ})]}{30 + 70 \exp [0.019 (T_i - T_{KLaQ})]} = 0 \quad (\text{X2.3})$$

where:

$K_{La(i)}$ = crack arrest datum at test temperature T_i
 n = number of valid K_{La} data

X2.3.4 The standard deviation, σ , of the natural logarithm of the crack arrest fracture toughness distribution is given by Eq X2.4:

$$\sigma^2 = \sum_{i=1}^n \frac{(\ln K_{La(i)} - \ln \{30 + 70 \exp [0.019 (T_i - T_{KLa})]\})^2}{n} \quad (\text{X2.4})$$

X2.3.5 Certain multi-temperature data sets may result in an oscillating iteration between two (or more) distinct T_{KLa} values

TABLE X2.1 Weight factors for multi temperature analysis

$T - T_{KLa}$ range (°C)	Weight factor n_i
50 to -10	1/6
-10 to -28	1/7
-29 to -35	1/8
-36 to -41	1/9
-41 to -45	1/10
-46 to -50	1/11

upon satisfying the $T_{KLa} \pm 50^\circ\text{C}$ limit of **X2.3.1**. In these instances, the T_{KLa} value reported shall be the average of the calculated values. One example is for hypothetical data with toughness values such that the initial T_{KLa} estimation requires that data at one temperature be excluded. The second iteration then results in the inclusion of this same data. Subsequent T_{KLa} iterations will then oscillate between the first and second estimations. This phenomenon is more likely for sparse data sets when test results exist near the $T_{KLa} \pm 50^\circ\text{C}$ limit. More testing to develop additional data will likely resolve this problem.

X2.3.6 Calculation of tolerance bounds—

Upper and lower tolerance bounds can be calculated using the following equation:

$$K_{La(0,xx)} = \exp [\ln (\bar{K}_{La}) + z\sigma] \quad (\text{X2.5})$$

where z is the inverse of the standard normal cumulative distribution for a probability, xx , and σ is the standard deviation of the natural logarithm of the crack arrest fracture toughness from Eq X2.4.

X2.4 Validation of T_{KLaQ} as T_{KLa} — $T_{KLa} = T_{KLaQ}$ if all of the following requirements are met:

X2.4.1 The apparatus requirements of Section 6 are met or exceeded,

X2.4.2 The specimen configuration and dimensions meet the requirements of Section 7,

X2.4.3 The specimens were tested within the requirements of Section 8,

X2.4.4 The specimens used in the calculation of T_{KLaQ} meet the validity requirements of 9.3, and

X2.4.5 The number of specimens tested within the allowable temperature range $T_{KLaQ} \pm 50^\circ\text{C}$, meets the requirement of Eq X2.2 and the corresponding **Table X2.1**

REFERENCES

- (1) Crosley, P. B., Fournery, W. L., Hahn, G. T., Hoagland, R. G., Irwin, G. R., and Ripling, E. J., "Final Report on Cooperative Test Program on Crack Arrest Toughness Measurements," *NUREG/CR-3261*, University of Maryland, College Park, MD, April 1983.
- (2) Barker, D. B., Chona, R., Fournery, W. L., and Irwin, G. R., "A Report on the Round Robin Program Conducted to Evaluate the Proposed ASTM Test Method for Determining the Crack Arrest Fracture Toughness, K_{La} , of Ferritic Materials," *NUREG/CR-4996 (ORNL/Sub/79-7778/4)*, University of Maryland, College Park, MD, January 1988.
- (3) Rosenfield, A. R., "Validation of Compact-Specimen Crack-Arrest Data," *Journal of Engineering Materials Technology*, Vol 106, 1984, pp. 207–208.
- (4) Kanninen, M. F., and Popelar, C. H., *Advanced Fracture Mechanics*, Oxford University Press, NY, 1985.
- (5) Cheverton, R. D., Ball, D. G., Bolt, S. E., Iskander, S. K., and Nanstad, R. K., "Pressure Vessel Fracture Studies Pertaining to the PWR Thermal Shock Issue: Experiments TSE-5, TSE-5A, and TSE-6," *NUREG/CR-4249(ORNL-6163)*, Oak Ridge National Laboratory, Oak Ridge, TN, June 1985.
- (6) Bryan, R. H., Bass, B. R., Bolt, S. E., Bryson, J. W., Edmonds, D. P., McCulloch, R. W., Merkle, J. G., Nanstad, R. K., Robinson, G. C., Thoms, K. R., and Whitman, G. D., "Pressurized-Thermal-Shock Test of 6-in.-Thick Pressure Vessels. PTSE-1: Investigation of Warm Prestressing and Upper-Shelf Arrest," *NUREG/CR-4106 (ORNL-6135)*, Oak Ridge National Laboratory, Oak Ridge, TN, April 1985.
- (7) Rosenfield, A. R., Mincer, P. N., and Marshall, C. W., "High-Temperature Crack-Arrest Toughness Measurements Using Compact Specimens," *Fracture Mechanics: Eighteenth Symposium, ASTM STP 945*, D. T. Read and R. P. Reed, eds., 1988, pp. 73–85.
- (8) Crosley, P. B., and Ripling, E. J., "Plane Strain Crack Arrest Characterization of Steels," *Journal of Pressure Vessel Technology*, November 1975.
- (9) Chona, R., Fournery, W. L., Link, R. E., and Sanford, R. J., "The Recoverability of Plastic Zone Energy in Crack Arrest," *Proceedings, 1985 SEM Spring Conference on Experimental Mechanics*, Las Vegas, NV, June 1985, pp. 13–19.
- (10) Underwood, J. H., Burch, I. A., and Ritter, J. C., "Crack-Arrest and Static Fracture Toughness Tests of a Ship Plate Steel," *Rapid Load Fracture Testing, ASTM STP 1130*, R. Chona and W. R. Corwin, eds., 1992, pp. 147–160.
- (11) Crosley, P. B., and Ripling, E. J., "Development of a Standard Test for Measuring K_{La} with a Modified Compact Specimen," *NUREG/CR-2294 (ORNL/Sub-81/7755/1)*, Materials Research Laboratory,

Glenwood, IL, August 1981.

- (12) Rosenfield, A. R., Mincer, P. N., Marschall, C. W., and Markworth, A. J., “Recent Advances in Crack-Arrest Technology,” *Fracture Mechanics: Fifteenth Symposium, ASTM STP 833*, R. J. Sanford, ed., 1984, pp. 149–164.
- (13) Bryan, R. H., Bass, B. R., Bolt, S. E., Bryson, J. W., Corwin, W. R., Merkle, J. G., Nanstad, R. K., and Robinson, G. C., “Pressurized Thermal-Shock Tests of 6-in.-Thick Pressure Vessels. PTSE-2: Investigation of Low Tearing Resistance and Warm Prestressing,” *NUREG/CRE-4888(ORNL-6377)*, Oak Ridge National Laboratory, Oak Ridge, TN, December 1987.
- (14) Freund, L. B., Hutchinson, J. W., and Lam, P. S., “Analysis of High-Strain-Rate Elastic-Plastic Crack Growth,” *Engineering Fracture Mechanics*, Vol 23, No. 1, 1986, pp. 119–129.
- (15) Milella, P. P., Pina, A., and Caracciolo, M. B., “Assessment of Crack-Arrest Properties of Nuclear Pressure Vessel Steels by Means of Small Specimens,” *SMiRT Proceedings*, Vol G, AASmirt, Los Angeles, CA, 1989, pp. 125–130.
- (16) “Heavy-Section Steel Irradiation Program Semiannual Progress Report for October 1986 to March 1987,” *NUREG/CR-4219(ORNL/TN-9593/V4&N1)*, Oak Ridge National Laboratory, Oak Ridge, TN, August 1987, pp. 55–58.

ASTM International takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM International Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, at the address shown below.

This standard is copyrighted by ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or service@astm.org (e-mail); or through the ASTM website (www.astm.org). Permission rights to photocopy the standard may also be secured from the ASTM website (www.astm.org/COPYRIGHT/).