



Designation: E 2544 – 07

Standard Terminology for Three-Dimensional (3-D) Imaging Systems¹

This standard is issued under the fixed designation E 2544; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ε) indicates an editorial change since the last revision or reapproval.

1. Scope

1.1 This terminology contains common terms, definitions of terms, descriptions of terms, nomenclature, and acronyms associated with three-dimensional (3-D) imaging systems in an effort to standardize terminology used for 3-D imaging systems.

1.2 The definitions of the terms presented in 3.1 are obtained from various standard documents developed by various standards development organizations. The intent is not to change these universally accepted definitions but to gather, in a single document, terms and their definitions that may be used in current or future standards for 3-D imaging systems.

1.2.1 In some cases, definitions of the same term from two standards have been presented to provide additional reference. The text in parentheses to the right of each defined term is the name (and, in some cases, the specific section) of the source of the definition associated with that term.

1.3 The definitions in 3.2 are specific terms developed by this committee for 3-D imaging systems.

1.4 A definition in this terminology is a statement of the meaning of a word or word group expressed in a single sentence with additional information included in notes or discussions.

1.5 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

NOTE 1—The subcommittee responsible for this standard will review definitions on a five-year basis to determine if the definition is still appropriate as stated. Revisions will be made when determined necessary.

2. Referenced Documents

2.1 ASTM Standard:²

E 456 Terminology Relating to Quality and Statistics

2.2 ASME Standard:³

B89.4.19 Performance Evaluation of Laser Based Spherical Coordinate Measurement Systems

2.3 ISO Standard:⁴

VIM, International Vocabulary of Basic and General Terms in Metrology

2.4 NIST/SEMATECH Standard:⁵

NIST/SEMATECH e-Handbook of Statistical Methods

3. Terminology

3.1 Definitions:

accuracy of measurement, *n*—closeness of the agreement between the result of a measurement and a true value of the measurand. (VIM 3.5)

DISCUSSION—

(1) Accuracy is a qualitative concept.

(2) The term “precision” should not be used for “accuracy.”

bias (of a measuring instrument), *n*—systematic error of the indication of a measuring instrument. (VIM 3.25)

DISCUSSION—The bias of a measuring instrument is normally estimated by averaging the error of indication over an appropriate number of repeated measurements.

bias, *n*—difference between the average or expected value of a distribution and the true value.

(NIST/SEMATECH e-Handbook)

DISCUSSION—In metrology, the difference between precision and accuracy is that measures of precision are not affected by bias, whereas accuracy measures degrade as bias increases.

calibration, *n*—set of operations that establish, under specified conditions, the relationship between values of quantities indicated by a measuring instrument or measuring system, or

¹ This terminology is under the jurisdiction of Committee E57 on 3D Imaging Systems and is the direct responsibility of Subcommittee E57.01 on Terminology. Current edition approved Feb. 15, 2007. Published March 2007.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

³ Available from American Society of Mechanical Engineers (ASME), ASME International Headquarters, Three Park Ave., New York, NY 10016-5990, <http://www.asme.org>.

⁴ Available from American National Standards Institute (ANSI), 25 W. 43rd St., 4th Floor, New York, NY 10036, <http://www.ansi.org>.

⁵ Available from National Institute of Standards and Technology (NIST), 100 Bureau Dr., Stop 1070, Gaithersburg, MD 20899-1070, <http://www.nist.gov>. e-Handbook available at <http://www.itl.nist.gov/div898/handbook/>.

values represented by a material measure or a reference material, and the corresponding values realized by standards.
(VIM 6.11)

DISCUSSION—

(1) The result of a calibration permits either the assignment of values of measurands to the indications or the determination of corrections with respect to indications.

(2) A calibration may also determine other metrological properties such as the effect of influence quantities.

(3) The result of a calibration may be recorded in a document, sometimes called a calibration certificate or a calibration report.

compensation, *n*—the process of determining systematic errors in an instrument and then applying these values in an error model that seeks to eliminate or minimize measurement errors.
(ASME B89.4.19)

conventional true value (of a quantity), *n*—value attributed to a particular quantity and accepted, sometimes by convention, as having an uncertainty appropriate for a given purpose.
(VIM 1.20)

DISCUSSION—

(1) Examples: (1) at a given location, the value assigned to the quantity realized by a reference standard may be taken as a conventional true value and (2) the CODATA (1986) recommended value for the Avogadro constant, N_A : $6\,022\,136\,7 \times 10^{23} \text{ mol}^{-1}$.

(2) Conventional true value is sometimes called assigned value, best estimate of the value, conventional value, or reference value.

(3) Frequently, a number of results of measurements of a quantity is used to establish a conventional true value.

error (of measurement), *n*—result of a measurement minus a true value of the measurand.
(VIM 3.10)

DISCUSSION—

(1) Since a true value cannot be determined, in practice, a conventional true value is used (see true value and conventional true value).

(2) When it is necessary to distinguish “error” from “relative error,” the former is sometimes called “absolute error of measurement.” This should not be confused with the “absolute value of error,” which is the modulus of error.

indicating (measuring) instrument, *n*—measuring instrument that displays an indication.
(VIM 4.6)

DISCUSSION—

(1) Examples include analog indicating voltmeter, digital frequency meter, and micrometer.

(2) The display may be analog (continuous or discontinuous) or digital.

(3) Values of more than one quantity may be displayed simultaneously.

(4) A displaying measuring instrument may also provide a record.

limiting conditions, *n*—the manufacturer’s specified limits on the environmental, utility, and other conditions within which

an instrument may be operated safely and without damage.

DISCUSSION—The manufacturer’s performance specifications are not assured over the limiting conditions.

maximum permissible error (MPE), *n*—extreme values of an error permitted by specification, regulations, and so forth for a given measuring instrument.
(VIM 5.21)

measurand, *n*—particular quantity subject to measurement.
(VIM 2.6)

DISCUSSION—

(1) Example includes vapor pressure of a given sample of water at 20°C.

(2) The specification of a measurand may require statements about quantities such as time, temperature, and pressure.

precision, *n*—closeness of agreement between independent test results obtained under stipulated conditions.
(ASTM E 456)

DISCUSSION—

(1) Precision depends on random errors and does not relate to the true value or the specified value.

(2) The measure of precision is usually expressed in terms of imprecision and computed as a standard deviation of the test results. Less precision is reflected by a larger standard deviation.

(3) “Independent test results” means results obtained in a manner not influenced by any previous result on the same or similar test object. Quantitative measures of precision depend critically on the stipulated conditions. Repeatability and reproducibility conditions are particular sets of extreme stipulated conditions.

precision, *n*—*in metrology*, the variability of a measurement process around its average value.
(NIST/SEMATECH e-Handbook)

DISCUSSION—Precision is usually distinguished from accuracy, the variability of a measurement process around the true value. Precision, in turn, can be decomposed further into short-term variation or repeatability and long-term variation or reproducibility.

random error, *n*—result of a measurement minus the mean that would result from an infinite number of measurements of the same measurand carried out under repeatability conditions.
(VIM 3.13)

DISCUSSION—

(1) Random error is equal to error minus systematic error.

(2) Because only a finite number of measurements can be made, it is possible to determine only an estimate of random error.

rated conditions, *n*—manufacturer-specified limits on environmental, utility, and other conditions within which the manufacturer’s performance specifications are guaranteed at the time of installation of the instrument.
(ASME B89.4.19)

relative error, *n*—error of measurement divided by a true value of the measurand.
(VIM 3.12)

DISCUSSION—Since a true value cannot be determined, in practice a

conventional true value is used.

repeatability (of results of measurements), n —closeness of the agreement between the results of successive measurements of the same measurand carried out under the same conditions of measurement. (VIM 3.6)

DISCUSSION—

- (1) These conditions are called repeatability conditions.
- (2) Repeatability conditions include: the same measurement procedure; the same observer; the same measuring instrument used under the same conditions; the same location; and repetition over a short period of time.
- (3) Repeatability may be expressed quantitatively in terms of the dispersion characteristics of the results.

reproducibility (of results of measurements), n —closeness of the agreement between the results of measurements of the same measurand carried out under changed conditions of measurement. (VIM 3.7)

DISCUSSION—

- (1) A value statement of reproducibility requires specification of the conditions changed.
- (2) The changed conditions may include: principle of measurement; method of measurement; observer; measuring instrument; reference standard; location; conditions of use; and time.
- (3) Reproducibility may be expressed quantitatively in terms of the dispersion characteristics of the results.
- (4) Results are usually understood to be corrected results.

systematic error, n —mean that would result from an infinite number of measurements of the same measurand carried out under repeatability conditions minus a true value of the measurand. (VIM 3.14)

DISCUSSION—

- (1) Systematic error is equal to error minus random error.
- (2) Like true value, systematic error and its causes cannot be completely known.
- (3) For a measuring instrument, see “bias.”

true value (of a quantity), n —value consistent with the definition of a given particular quantity. (VIM 1.19)

DISCUSSION—

- (1) This is a value that would be obtained by a perfect measurement.
- (2) True values are by nature indeterminate.
- (3) The indefinite article “a,” rather than the definite article “the,” is used in conjunction with “true value” because there may be many values consistent with the definition of a given particular quantity.

uncertainty of measurement, n —parameter, associated with the result of a measurement, that characterizes the dispersion of the values that could reasonably be attributed to the

measurand.

(VIM 3.9)

DISCUSSION—

(1) The parameter may be, for example, a standard deviation (or a given multiple of it) or the half width of an interval having a stated level of confidence.

(2) Uncertainty of measurement comprises, in general, many components. Some of these components may be evaluated from the statistical distribution of the results of series of measurements and can be characterized by experimental standard deviations. The other components, which can also be characterized by standard deviations, are evaluated from assumed probability distributions based on experience or other information.

(3) It is understood that the result of the measurement is the best estimate of the value of the measurand, and that all components of uncertainty, including those arising from systematic effects, such as components associated with corrections and reference standards, contribute to the dispersion.

3.2 Definitions of Terms Specific to This Standard:

3-D imaging system, n —an optical (within the infrared to ultraviolet wavelengths) instrument that is used to rapidly measure (on the order of thousands of measurements per second or faster) the range and bearing to and/or the 3-D coordinates of points on an object or within an area of interest.

DISCUSSION—

(1) Examples of 3-D imaging systems are laser scanners (also known as LADARs or laser radars), optical range cameras (also known as flash LADARs or 3-D range cameras), triangulation based systems such as those using pattern projectors or lasers, and other systems based on interferometry.

(2) In general, the information gathered by a 3-D imaging system is a collection of n -tuples, where in addition to spherical or Cartesian coordinates, each n -tuple can also include return pulse intensity, color, time stamp, identifier, polarization, and so forth.

(3) For some instruments, each n -tuple does not include spherical or Cartesian coordinates, instead the n -tuple is a range waveform which could be post-processed to extract the coordinates and/or object classifications or attributes.

(4) Measurements are made without physical contact between the instrument and the object.

angular increment, n —the angle between samples, $\Delta\alpha$, where $\Delta\alpha = \alpha_i - \alpha_{i-1}$, in either the azimuth or elevation directions (or a combination of both) with respect to the instrument's internal frame of reference.

DISCUSSION—For scanning instruments, the angular increment may also be known as the angle step size.

first return, n —for a given emitted pulse, it is the first reflected signal that is detected by a 3-D imaging system, time-of-flight (TOF) type, for a given sampling position, that is, azimuth and elevation angle.

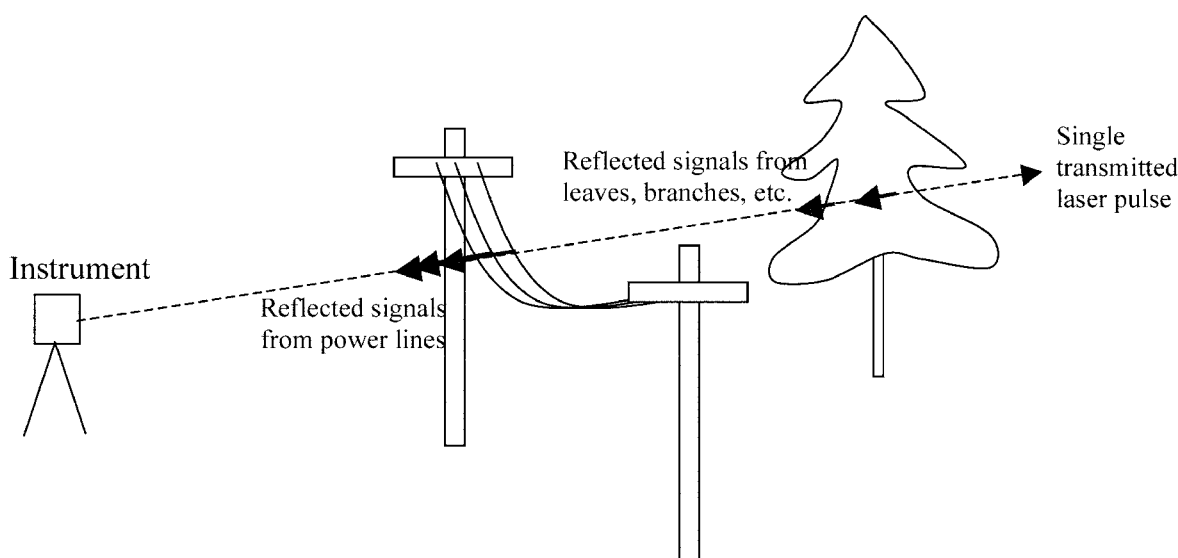


FIG. 1 Multiple Returns

flash LADAR, *n*—3-D imaging system, comprised of a source of light (commonly a laser, but for close proximity it can be a bank of LEDs) and a focal plane array (FPA) detector, that is designed so that the range (and in some cases intensity) for all the pixels in the frame are acquired nearly simultaneously in a single flash of illumination.

DISCUSSION—Flash LADAR approaches may allow for the achievement of high frame rates (for example, 30 frames per second or faster) which is critical for real time applications such as collision avoidance and autonomous vehicle navigation.

instrument origin, *n*—point from which all instrument measurements are referenced, that is, origin of the instrument coordinate reference frame (0, 0, 0).

last return, *n*—for a given emitted pulse, it is the last reflected signal that is detected by a 3-D imaging system, time-of-flight (TOF) type, for a given sampling position, that is, azimuth and elevation angle.

multiple returns, *n*—for a given emitted pulse, a laser beam hitting multiple objects separated in range is split and multiple signals are returned and detected (see Fig. 1).

pixel, *n*—a single cell in a focal plane array sensor, or a discrete element in a 2D grid representation of data.

DISCUSSION—

(1) The term pixel was originally coined to stand for “picture element” in the image analysis domain.

(2) In computer graphics, a pixel represents the smallest discrete element of an image displayed on a screen. Pixel shape

is dependent on the technology used to display it. Pixel size has also been used to describe the resolution of a sensor, but pixel size can also be an arbitrary dimension specified by the user (for example, it is possible to “pixelate” a digital image so that the smallest pixel size becomes a multiple of the smallest pixel size in the original image).

(3) In 3-D imaging applications, 2D projections of point clouds are often displayed on a computer screen (or printed). Hence, although the underlying data may be 3-D, it is visualized in terms of pixels projected onto a 2D grid.

voxel, *n*—a discrete volumetric element in a 3-D grid representation of data.

DISCUSSION—The term voxel is derived from volumetric pixel.

3.3 Acronyms:

APD, *n*—avalanche photo diode.

CCD, *n*—charge-coupled device.

FOV, *n*—field of view.

FOR, *n*—field of regard

FPA, *n*—focal plane array.

LADAR, *n*—laser detection and ranging system.

LIDAR, *n*—light detection and ranging system.

4. Keywords

4.1 3-D imaging system; LADAR; laser detection and ranging system; LIDAR; three-dimensional imaging system

ASTM International takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM International Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, at the address shown below.

This standard is copyrighted by ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or service@astm.org (e-mail); or through the ASTM website (www.astm.org).