



Standard Test Method for Measuring Abrasion Resistance of Materials by Abrasive Loop Contact¹

This standard is issued under the fixed designation G174; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ε) indicates an editorial change since the last revision or reapproval.

^{ε1} NOTE—Minor editorial changes were made throughout in May 2009.

1. Scope

1.1 This test method covers ranking rigid engineering materials for abrasion resistance in rubbing against aluminum oxide abrasive finishing tape. Though most solids can be tested, this test method addresses its use for metals, and coatings applied to metals.

1.2 The values stated in SI units are to be regarded as standard. No other units of measurement are included in this standard.

1.3 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

2. Referenced Documents

2.1 *ASTM Standards:*²

E177 Practice for Use of the Terms Precision and Bias in ASTM Test Methods

E178 Practice for Dealing With Outlying Observations

E691 Practice for Conducting an Interlaboratory Study to Determine the Precision of a Test Method

G40 Terminology Relating to Wear and Erosion

G117 Guide for Calculating and Reporting Measures of Precision Using Data from Interlaboratory Wear or Erosion Tests

G132 Test Method for Pin Abrasion Testing

3. Terminology

3.1 *Definitions:*

¹ This test method is under the jurisdiction of ASTM Committee G02 on Wear and Erosion and is the direct responsibility of Subcommittee G02.30 on Abrasive Wear.

Current edition approved May 1, 2009. Published May 2009. Originally approved in 2003. Last previous edition approved in 2004 as G174–04. DOI: 10.1520/G0174-04R09E01.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

3.1.1 *abrasive wear, n*—wear due to hard particles or hard protuberances forced against, and moving along, a solid surface.

3.2 *Definitions of Terms Specific to This Standard:*

3.2.1 *abrasion, n*—the process of abrasive wear.

3.2.1.1 *Discussion*—Terminology G40 does not define abrasion.

3.2.2 *abrasion resistance, n—in tribology*, the ability of a material to resist damage or attrition by abrasion.

3.2.3 *fixed abrasive tape, n*—hard particles or grains bonded (fixed) to one side of a flexible web with a resin or similar binder. The particles can be of any hard material and vary in size. (This abrasive medium is also known as “finishing tape,” “microfinishing tape,” “microfinishing film,” or “finishing film.”)

3.2.4 *flexible web, n*—plastic, paper, rubber, or other material that is thin enough to conform to a 180° wrap around a 16-mm diameter cylinder under a tension of less than 1.8 kg/cm width.

4. Summary of Test Method

4.1 This test involves rubbing an abrasive tape loop initially in line-contact with a solid surface. The tape abrasion produces a groove in the test surface, and the volume of material removed in a designated amount of abrasive rubbing is measured by mass loss or by calculation from the groove geometry. The continuous loop of abrasive is used for the duration of the test and then discarded. A fresh loop is used for each one-hour test.

4.2 The wear volume produced in this test provides a measure of the ability of a surface to resist wear damage from abrasive substances. The smaller the wear volume in this test, the better the abrasion resistance.

4.3 The test was developed using 30 μm-mean diameter aluminum oxide abrasive on a 127 μm-thick polyester support, but other commercially available abrasive tapes could be used. The test has also been used with webs such as paper that are inherently abrasive to many materials.

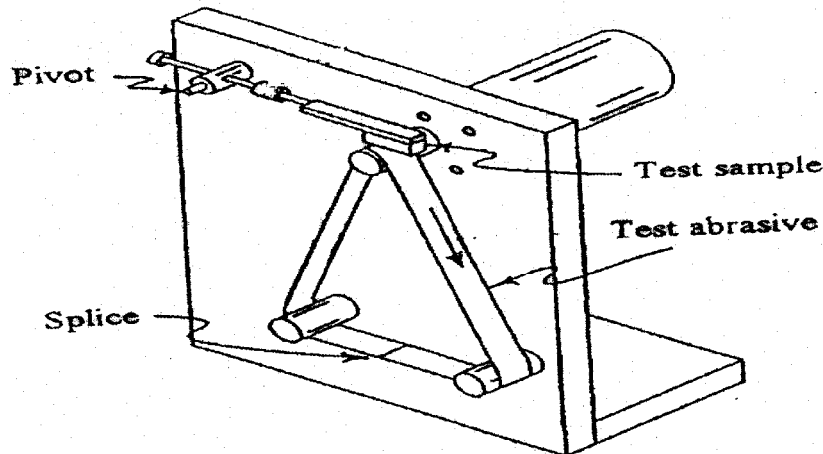


FIG. 1 Schematic of Test Rig

5. Significance and Use

5.1 This test is useful for screening materials for use in tools that are subjected to abrasion from the material that is being machined, worked, or formed. It has been used to screen tool steels for punch press dies, hardfacings for earth-moving machinery, and wear coatings. This is simpler to build and use than those used in the Test Method G132 abrasion test which, like this test, uses a fixed abrasive counterface to abrade a test material.

5.2 The one-hour test is intended for metals and materials that are softer than hardened steel (67 HRC), but may be applied to harder materials (see 7.1.7).

6. Apparatus

6.1 The test apparatus used in interlaboratory tests is illustrated in Fig. 1. A 132-cm long by 25.4-mm wide abrasive tape is made into a continuous loop with a pressure sensitive adhesive (PSA) butt splice (Fig. 2). The web is tensioned to form a triangle with the 16-mm diameter drive spindle at the apex. The idler rolls can be of any diameter, but a convenient size is about 50 mm radius with flanges to prevent lateral movement of the tape. The test sample shall have the dimensions shown in Fig. 3. It is clamped or attached to the counterbalanced loading arm with PSA foam. The loading arm is pivoted on rolling element bearings. A 200 g loading mass is attached to the pivot arm and centered directly over the line contact between the specimen and drive spindle.

6.2 One idler roller must be adjustable to produce tape tension sufficient to drive the tape with spindle-to-tape slippage of less than 20 m in a one-hour test time. The drive spindle shall be 16 mm in diameter and have a total indicated run-out of less than 20 μ m at a rotational speed of 300 rpm.

7. Test Procedure

7.1 Standard Test for Metals Softer than 67 HRC:

7.1.1 *Specimen Preparation*—The test surfaces (7.6 by 32 mm) should have a ground or lapped finish with a roughness

less than 0.2 μ m Ra. The surface lay shall be aligned with the long axis of the test specimen. When testing molded surfaces or specific finishes, the test samples should have the finish of interest on the test faces.

7.1.2 *Cleaning*—Cleaning is not needed if the test surfaces are untouched after the sample preparation and no lubricants, and so forth, were used in fabrication. If the surfaces are contaminated, clean in a solvent that will not leave a surface film or degrade the properties of the test surface (acetone is suitable for most metals).


7.1.3 *Weighing*—If mass change is going to be used as the test metric, weigh the test specimen to the nearest tenth of a milligram and record this as the initial weight.

7.1.4 *Sample Attachment*—Affix the test sample to loading arm and the 200 g-loading mass over the line where the specimen has tangential contact with the tape.

7.1.5 *Belt Tensioning*—Tension the abrasive belt over the drive spindle and idler rollers by moving idler rollers. Check the loop for slip with a mark on the tape and spindle. Loops are used only once for one hour.

7.1.6 *Check Systems Alignment*—Tapered scars will result if the sample is not parallel to the drive spindle. Check alignment by putting pressure sensing media on the spindle and bring the specimen in contact with the spindle. The pressure-sensing medium must show line contact across the sample width. Thin foils (less than 25 μ m) can also be used to make sure that both edges of the test sample are contacting the spindles. Put the foil between the spindle and the edge of the sample and pull the foil out. Repeat on the other side. Equal pull force on both sides shows good alignment, and can be measured with a force measuring device. Lock the aligned sample arm in place. Put the loop on and tension it as in 7.1.5. Turn the tester on for 5 to 10 s and lift the sample arm and check for a uniform wear scar across the sample width.

7.1.7 *Testing*—Set the spindle rotational speed to 300 rpm and turn the tester on. Start timing or set a time on the machine power to shut off after one hour.

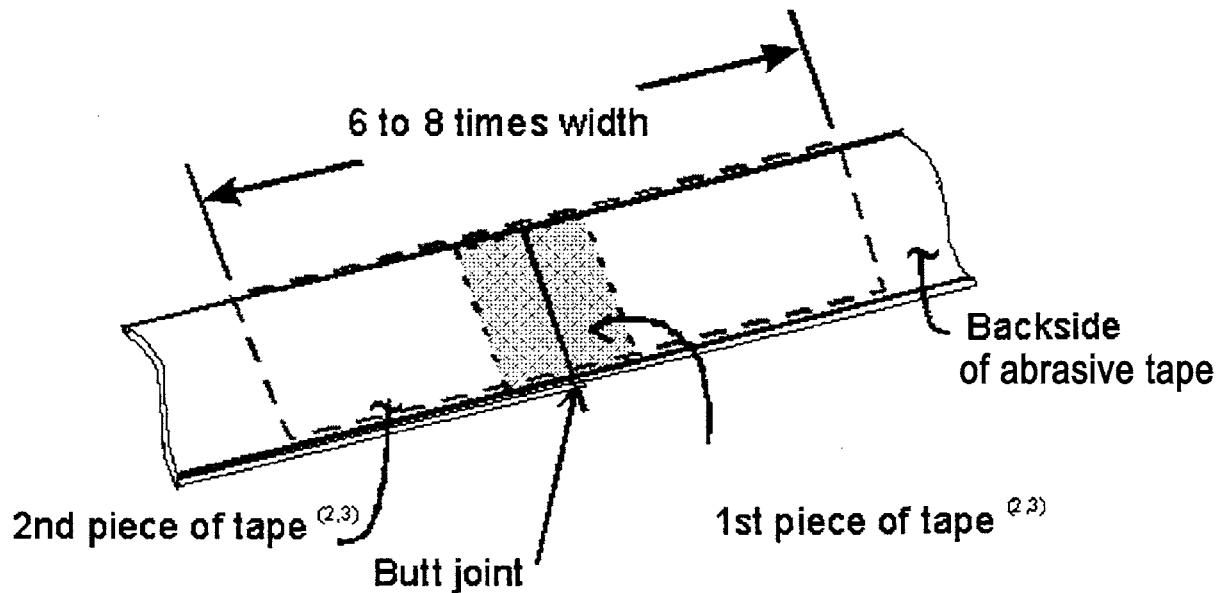

1—8 mil-thick microfinishing film was used in interlaboratory tests. It was purchased at:

3M Corporation
Imperial Lapping Film 262L
Grade 30 MIC, Mineral A/O
Backing 5 mil Size 1 by 150 by 3 in.


2—Scotch Magic Tape (3M Corp.) was used in interlaboratory tests

3—3M Corp.

3M Center, Building 251-2A-08
St. Paul, MN 55144-1000 USA

NOTE 1—Some tapes may have a release agent on the back that must be removed by abrasion followed by solvent wipe.

FIG. 2 Loop Splicing Detail

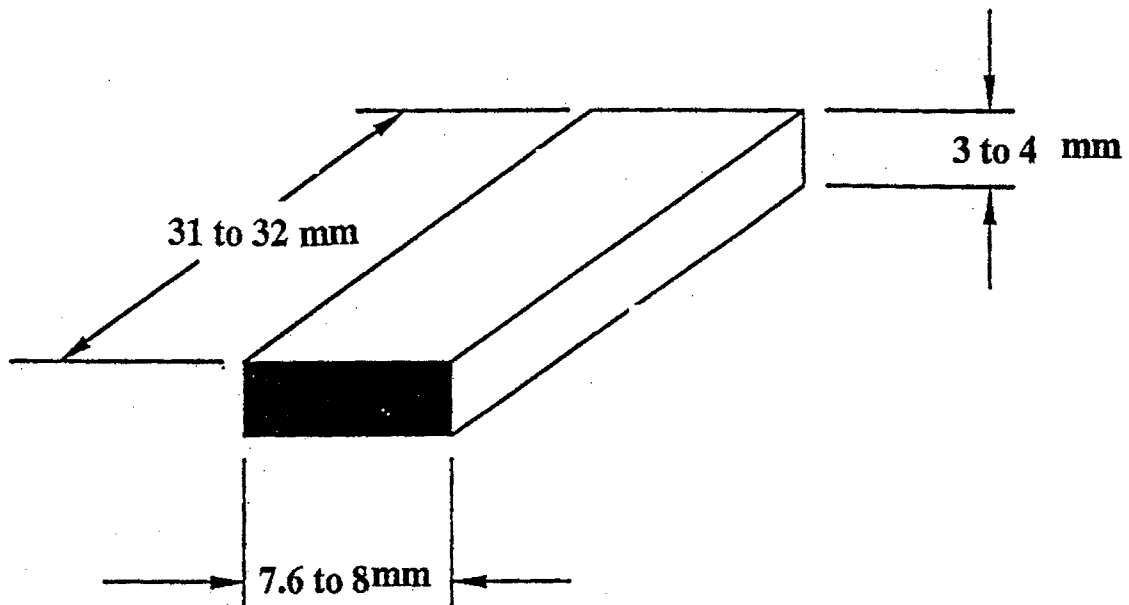


NOTE 1—0.1 to 0.2 μm Ra surface roughness on test surface.

FIG. 3 Loop Abrasion Test Sample

NOTE 1—Some cemented carbides and other hard materials may require a longer time to develop a measurable wear scar. Sometimes these materials require several one-hour test cycles with the tape changed each hour. This is a non-standard test and is not covered by this method.

7.1.8 *Scar Measurement*—Clean wear debris from the specimen with an acetone or alcohol wipe or other suitable technique. Measure the scar width in at least three places

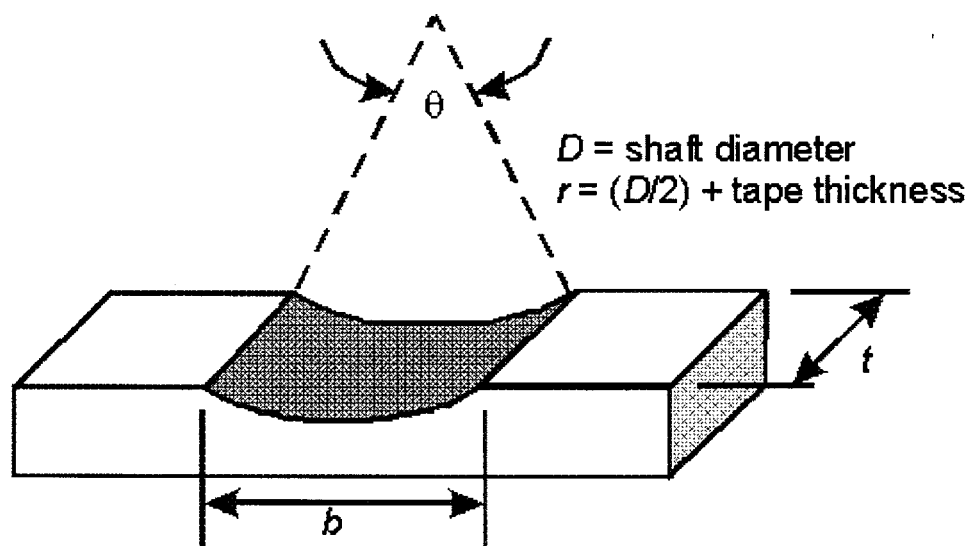

$$V_{\text{scar}} = \frac{D^2 t}{8} \left[2 \sin^{-1} \frac{b}{D} - \sin \left(2 \sin^{-1} \frac{b}{D} \right) \right]$$

FIG. 4 Scar Measurement

(edge-center-edge) to within 0.1 to 0.25 mm. Calculate sample wear volume using the following equation or other model for calculating a segment of a cylinder (see Fig. 4).

7.1.9 Measurement of Mass Change—If gravimetric measurement is used as the test metric, weigh the sample to ± 10 mg and subtract this mass from the initial mass. Take the mass change and convert it into wear volume by dividing by the density for the test material.

NOTE 2—Mass loss is usually not used on tool steels and similar hard materials. Scar measurement is usually more accurate.

7.2 Test option for thin (<50 μm) hard coatings and surface treatments:

7.2.1 Testing—Set the spindle rotational speed to 300 rpm, install a 3 μm aluminum oxide loop and a 100 g loading mass, and jog the machine to produce about 400 mm of loop abrasion on the specimen. Check to ensure uniform contact across the width of the specimen. Adjust the specimen arm if necessary and initial the test in a new spot on the specimen. Repeat this until uniform marking is accomplished within 400 mm of abrasion.

7.2.2 When uniform contact is established, test the coating or treatment until penetration just starts and terminate the test. Decade testing (1 loop pass, 10 loop passes, 100 loop passes, and 1000 loop passes) is recommended as a way to assess when the coating or treatment may abrade through. If it is intact at 10 loop passes, but well penetrated at 100 loop passes, the penetration can be determined by checking for penetration at 20, 30, 40, and so forth, loop passes. Penetration is determined optically in most cases, but etching or similar techniques might be needed for some surface treatments.

7.2.3 Measurement for Mass Change—Same as 7.1.9.

7.2.4 Measurement of Wear Volume from Scar Size—The scar width at penetration should be measured optically ± 100 μm and wear volume is calculated from the equation in Fig. 4. For coatings with thickness less than a few micrometres, it is recommended that wear volume be determined by profilometry of the scar depth at the point of penetration. Take several scar depth profiles; determine the average cross-sectional area of the scar and multiply the average area by the scar width to obtain a scar volume.

7.2.5 Test Metric—The test metric for abrasion resistance of coating and surface treatments is wear volume in cubic millimetres divided by loop passes in metres (number of passes to penetrate multiplied by 1.32 m per pass), mm^3/m .

7.3 Other test options are summarized in Table X1.2.

8. Report

8.1 Report the following:

8.1.1 Test material including all details on manufacture, treatment, and surface texture,

8.1.2 Abrasive tape used, grit size, grit material, tape thickness, and width.

8.1.3 Conditions: normal force, total abrasion distance, tape speed, number of replicates, test temperature and relative humidity, test metric (scar size or mass change), and

8.1.4 Wear volume (average and standard deviation).

9. Precision and Bias

9.1 Precision—The precision of an individual scar measurement can be checked by using mass change and different ways

of measuring the scar by physical measurement. If all techniques produce the same wear volume, the measurement will be precise. Physical measurements usually include optical or profilometer measurement of scar width followed by calculations to yield wear volume. Profilometer software is available for the calculation of wear from scar geometry.

9.2 Repeatability and Reproducibility—The repeatability of the test depends on the homogeneity of the test material, the uniformity of the test abrasive sample/spindle alignment, tape/spindle slips and environmental conditions. All of these factors should be kept constant. The reproducibility of this test on hard and soft steels is shown in **Appendix X1**. The within-lab coefficient of variation was 7.5 to 12.3 %; between labs was 35.6 to 43.9 %. The COV is well below 10 % in labs where this test is in continuous use. The interlaboratory test increase probably reflects operator differences. The reproduc-

ibility would be better if more experienced operators were used. This test was new to some interlaboratory test collaborators. A standard reference material can be periodically tested to check for lot-to-lot variability in abrasive, but this has not been a factor in the years that the test was in use before standardization. Interlaboratory test data were analyzed using procedures and methods outlined in ASTM standards on interlaboratory tests: Practices **E177**, **E178**, **E691**, and Guide **G117**.

9.3 Bias—Since there is no reference material for determining the bias of a loop abrasion resistance for a material, there is no basis upon which to determine bias.

10. Keywords

10.1 abrasion; abrasion resistance; abrasive wear; aluminum oxide; finishing tape; fixed abrasive; tape

APPENDIX

(Nonmandatory Information)

X1. HARD AND SOFT STEEL RESULTS USING THE STANDARD PROCEDURE ON A LOADING MASS OF 200 g

X1.1 See **Table X1.1** and **Table X1.2**.

TABLE X1.1 ASTM G02 Interlaboratory Test Data—Statistical Analysis^A

Hard Test Conditions	Lab #	Number of Replicates	Average, mm ³	Within-Lab Repeatability		Between-Lab Reproducibility	
				STD DEV, mm ³	k-Statistic	DEV from AVG, mm ³	H-Statistic
	1	3	2.604	0.395	1.897	0.905	1.248
	2	3	1.170	0.099	0.475	-0.529	0.729
	3	3	1.006	0.069	0.331	-0.693	0.955
	4	3	2.015	0.053	0.255	0.316	0.436
	4	3	1.699	0.208		0.745	
	Number	Average	Average	Within-Lab STD DEV		Between-Lab STD DEV (PROV)	
			C.O.V. (%) =	12.2		43.8	
			95% Limits =	0.58		2.09	
Use the larger of the 95% limits for the final value				Within-Lab k crit = 1.82		Between-Lab h crit = 1.49	
				Any individual k and h values greater than k crit and h crit suggest that those data should be examined for “outliers”			

Recommended statement of precision: The average test value was 1.70 mm³
 with a 95% repeatability limit (within-lab) of 0.58 mm³
 and a 95% reproducibility limit (between-labs) of 2.09 mm³

Soft Test Conditions	Lab #	Number of Replicates	Average, mm ³	Within-Lab Repeatability		Between-Lab Reproducibility	
				STD DEV, mm ³	k-Statistic	DEV from AVG, mm ³	H-Statistic
	1	3	19.300	0.563	0.563	5.991	1.283
	2	3	9.405	0.375	0.375	-3.904	0.836
	3	3	9.531	1.447	1.447	-3.778	0.809
	4	3	15.000	1.204	1.204	1.691	0.362
	4	3	13.309	1.000		4.740	
	Number	Average	Average	Within-Lab STD DEV		Between-Lab STD DEV (PROV)	
			C.O.V. (%) =	6.0		35.4	
			95% Limits =	2.24		13.2	
Use the larger of the 95% limits for the final value				Within-Lab k crit = 1.82		Between-Lab h crit = 1.49	
				Any individual k and h values greater than k crit and h crit suggest that those data should be examined for “outliers”			

Recommended statement of precision: The average test value was 13.31 mm³
 with a 95% repeatability limit (within-lab) of 2.24 mm³
 and a 95% reproducibility limit (between-labs) of 13.2 mm³

^A Interlaboratory tests were conducted on test equipment made by Bud Labs, 3177 Latta Road, Suite 146, Rochester, NY 14612-3092, Model 01.

TABLE X1.2 Testing Options

	Abrasive Type	Abrasive Size (mm)	Spindle Speed (rpm)	Loading Mass (g)	Test Duration (s)	Number of Abrasive Loops Used
G174 Standard for Uncoated Metals	Al ₂ O ₃	30	300	200	680	1
Option A for thin (<50 μm hard coatings)	Al ₂ O ₃	3	100	100	680, or to penetration	1
Option B for thick (50 to 2500 μm) thermal spray or plated coatings	Al ₂ O ₃	30	100	100	75, or to penetration	1
Option C for uncoated cemented carbides, cermets, and ceramics	Al ₂ O ₃	30	100	100	80	4 (fresh every 20 passes)



G174 – 04 (2009)^{e1}

ASTM International takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM International Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, at the address shown below.

This standard is copyrighted by ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or service@astm.org (e-mail); or through the ASTM website (www.astm.org). Permission rights to photocopy the standard may also be secured from the ASTM website (www.astm.org/COPYRIGHT/).