

Recommended Testing Methods for Physical Protection of Wiring Harnesses**TABLE OF CONTENTS**

1.	Scope	3
1.1	Rationale	3
1.2	Application.....	3
2.	Applicable Publications	3
2.1	SAE Publications.....	3
2.2	ASTM Publications.....	3
2.3	ISO Publications.....	4
3.	Glossary	4
4.	Quality Requirements.....	5
4.1	Product Quality Assurance	5
5.	Classification (Temperature Identification)	5
6.	Testing Methods.....	6
7.	Tests Procedures	6
7.1	Sampling	6
7.2	Sample Preparation	6
7.2.1	Tape	6
7.2.2	Extruded Tube.....	6
7.2.3	Textile Tube	7
7.3	Heat Aging.....	7
7.4	Temperature/Humidity Cycling.....	8
7.5	Flammability	8
7.6	Low Temperature Flexibility	8
7.7	Fluids Resistance	8
7.8	Fogging	9
7.9	Component Compatibility	9
7.10	Noise Suppression.....	10

SAE Technical Standards Board Rules provide that: "This report is published by SAE to advance the state of technical and engineering sciences. The use of this report is entirely voluntary, and its applicability and suitability for any particular use, including any patent infringement arising therefrom, is the sole responsibility of the user."

SAE reviews each technical report at least every five years at which time it may be reaffirmed, revised, or cancelled. SAE invites your written comments and suggestions.

Copyright © 2005 SAE International

All rights reserved. No part of this publication may be reproduced, stored in a retrieval system or transmitted, in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, without the prior written permission of SAE.

TO PLACE A DOCUMENT ORDER: Tel: 877-606-7323 (inside USA and Canada)

Tel: 724-776-4970 (outside USA)

Fax: 724-776-0790

Email: custsvc@sae.org

SAE WEB ADDRESS:

<http://www.sae.org>

SAE J2192 Issued MAY2005

7.11	Abrasion Resistance	12
7.12	Puncture/Pinch	12
7.13	Dynamic Cut-Through	12
7.14	Impact Resistance Test (Convolute Only)	12
7.15	Thermal Insulation.....	13
8.	Product Appearance and Quality	14
9.	Supplier Responsibility.....	14
10.	Toxicology Conformance	14
11.	Product Approval.....	14



1. Scope

This SAE Recommended Practice describes the recommended methods for testing flexible harness coverings for use on ground vehicle electrical distribution systems. This Recommended Practice shall apply to all tapes, extruded tube and textile tube.

1.1 Rationale

Establishing a recommended methodology will allow the performance of tapes, extruded-tubing and textile-tubing harness coverings to be evaluated per a standard method, and this will further facilitate the future establishment of performance requirements for such coverings.

1.2 Application

This document shall be applied for coverings used on wiring assemblies. The Customer's Engineering Group must approve material based on the functional application performance requirements to assure proper validation of covering materials.

2. Applicable Publications

The following publications form a part of this specification to the extent specified herein. Unless otherwise specified, the latest issue of publications shall apply.

2.1 SAE Publications

Available from SAE, 400 Commonwealth Drive, Warrendale, PA 15096-0001.

SAE ARP1536A—Abrasion Test Procedure for Chafe Guard
SAE J311—Fluid for Passenger Car Type Automatic Transmission
SAE J369—Flammability of Polymeric Interior Materials – Horizontal Test Method
SAE J1128—Low Temperature Primary Cable
SAE J1756—Test Procedure to Determine the Fogging Characteristics of Interior Automotive Materials
SAE J2302—Thermal Effectiveness of Sleeve Insulation
SAE J2495—Thermal Containment Efficiency of Sleeve Materials

2.2 ASTM Publications

Available from ASTM, 100 Barr Harbor Drive, West Conshohocken, PA 19428-2959.

ASTM D 471—Standard Test Method for Rubber Property – Effect of Liquids
ASTM D 3032—Standard Test Methods for Hookup Wire Insulation, Section 22 – Dynamic Cut Through
ASTM D 4157—Test Method for Abrasion Resistance of Textile Fabrics
ASTM D 5423—Forced-Convection Laboratory Ovens for Evaluation of Electrical Insulation
ASTM F 1306—Test Method for Slow Rate Penetration Resistance of Flexible Barrier Films

This document is now
POOBLIC

2.3 ISO Publications

Available from ANSI, 25 West 43rd Street, New York, NY 10036-8002.

ISO 3795—Road vehicles, and tractors and machinery for agriculture and forestry – Determination of burning behavior of interior materials
Applicable Quality Standards (e.g., QS 9000, ISO/TS16949, etc)

3. Glossary

3.1 Functionality

Performs to design intent.

3.2 Degradation

Loss of functionality due to physical changes such as cracks, tears, melting or other forms of reduction in material strength, composition or integrity.

3.3 Exterior Application

Applications outside the passenger compartment

3.4 Interior Application

Applications inside the passenger compartment.

3.5 Recommended Practices

Suggested test method that does not include specification limits.

3.6 Tape

Polymeric or cloth material with or without adhesive.

3.7 Extruded Tube

Homogenous polymeric components consisting of thermoplastic and thermo-set materials. (e.g. convolute, vinyl and heat shrink)

3.8 Textile Tube

Components consisting of braided, knitted or woven constructions.

This document is now
POOBLIC

4. *Quality Requirements*

4.1 **Product Quality Assurance**

Product Quality Assurance must follow the requirements and be in compliance with the applicable Quality Standard.

5. *Classification (Temperature Identification)*

Temperature requirement is by class as noted in Table 1. It is the responsibility of the customer to determine the "Class" to be used for any application. Temperature ratings are to be considered the minimum service temperature required.

It is the responsibility of the supplier to properly designate the service temperature of their product and provide the necessary data to the performance criteria in this specification when submitting to the customer for approval. Verification of any and all of the data submitted by the supplier is at the discretion of the customer.

TABLE 1

Class	Temperature (°C)
Class A	-40 to 85
Class B	-40 to 100
Class C	-40 to 125
Class D	-40 to 150
Class E	-40 to 175
Class F	-40 to 200
Class G	-40 to 225
Class H	-40 to 250

This document is now
POOBLIC

6. Testing Methods

The recommended test methods are found in Table 2.

TABLE 2

Test	Category			Applicable Class	Test Method
	Tape	Extruded Tube	Textile Tube		
Heat Aging	X	X	X	All Classes	7.3
Temperature/Humidity	X	X	X	All Classes	7.4
Flammability	X	X	X	All Classes	7.5
Low Temperature Flexibility	X	X	X	All Classes	7.6
Automotive Fluids Resistance	X	X	X	For Exterior Applications Only	7.7
Fogging	X	X	X	For Interior Applications Only	7.8
Component Compatibility	X	X	X	All Classes	7.9
Noise Suppression	X	X	X	Customer Designated	7.10
Abrasion Resistance	X	X	X	Customer Designated	7.11
Puncture/Pinch	X	X		Customer Designated	7.12
Cut Through	X	X	X	Customer Designated	7.13
Impact		X		Customer Designated	7.14
Thermal Insulation	X	X	X	Customer Designated	7.15

7. Tests Procedures

7.1 Sampling

If it is not specified, the sample size must be five (5). The suggested dimension of the sample is 10 mm minimum, however, if the manufacturer is supplying sizes other than 10 mm, the customer may request other sample sizes. Selection must be representative of the current production for each test and test results should be reported. Precondition/equilibrate dry samples to $23^{\circ}\text{C} \pm 5^{\circ}\text{C}$ and $50\% \pm 5\%$ relative humidity for a minimum of 24 hours prior to testing unless otherwise noted.

7.2 Sample Preparation

7.2.1 TAPE

Assemble a bundle of wire 450 mm in length of an appropriate number and size to approximate a diameter of 10 mm as designated by customer. If specified, cover the bundle with a 450 mm length of 10 mm diameter convoluted tubing. Note that the appropriate wire type and tubing with the same operation temperature, as the tape in question must be used. Wrap the tape to be tested around the bundle with a 50% overlap.

7.2.2 EXTRUDED TUBE

Assemble a bundle of wire 450 mm in length of wire of an appropriate number and size to approximate a diameter of 10 mm. Cover the bundle with a 450 mm length of test specimen. Note that the appropriate wire type with the same continuous operating temperature must be used with the extruded tube being tested as specified by the customer or test method.

This document is now
POOBLIC

7.2.3 TEXTILE TUBE

Assemble a bundle of wire 450 mm in length of an appropriate number and size to approximate a diameter of 10 mm. Cover the bundle with a 450 mm length of braid. Note that the appropriate wire type with the same continuous operating temperature must be used with the textile tube being tested as specified by the customer or test method.

7.3 Heat Aging

7.3.1 The material shall withstand temperature according to class noted in Table 3, and tested according to the procedure described in 8.3.2.

7.3.2 Place 30 pieces of 450 mm long test specimens of each sample in a forced air convection oven (Type II as specified in ASTM D 5423, with air exchange rate of 100 to 200 per hour) at the sample maximum class temperature (Refers to Table 3) for the duration of time interval.

TABLE 3—TEST TEMPERATURE FOR HEAT AGING AND TEMPERATURE/HUMIDITY CYCLING

Class	Temperature (°C)
Class A	85 ± 2
Class B	100 ± 2
Class C	125 ± 3
Class D	150 ± 3
Class E	175 ± 3
Class F	200 ± 3
Class G	225 ± 4
Class H	250 ± 4

7.3.3 At 500, 1000, 1500, 2000, 2500, and 3000 hour intervals, remove five pieces of test specimens of each sample from the oven and condition them at 23 °C ± 5 °C and 50% ± 5 % relative humidity for at least 4 hours.

7.3.4 Wrap each of the conditioned test specimens around a mandrel with a diameter equal to four times the nominal ID of the test specimen at a uniform rate of one turn per 10 seconds. Visually inspect each specimen for any sign of degradation. Record and report any change in appearance and signs of degradation.

This document is now
POOBLIC

7.4 Temperature/Humidity Cycling

- 7.4.1 Place test specimens in an environmental chamber and set the cycling sequence as following for three cycles. Refer to SAE J1128, Temperature and Humidity Cycling Section, for complete description.

TABLE 4

Step	Condition	Duration	Total Time
1	Increase Temperature From $23\text{ }^{\circ}\text{C} \pm 5\text{ }^{\circ}\text{C}$ & $50\% \pm 5\% \text{ RH}$ to $-40\text{ }^{\circ}\text{C}$	30 minutes	0:30
2	Hold Temperature at $-40\text{ }^{\circ}\text{C} \pm 2\text{ }^{\circ}\text{C}$	1 hour	1:30
3	Increase Temperature From $-40\text{ }^{\circ}\text{C} \pm 2\text{ }^{\circ}\text{C}$ to $80\text{ }^{\circ}\text{C} \pm 2\text{ }^{\circ}\text{C}$ & $95\% \pm 5\% \text{ RH}$	30 minutes	2:00
4	Hold Temperature @ $80\text{ }^{\circ}\text{C} \pm 2\text{ }^{\circ}\text{C}$ & $95\% \pm 5\% \text{ RH}$	4 hours	6:00
5	Change Temperature From $80\text{ }^{\circ}\text{C} \pm 2\text{ }^{\circ}\text{C}$ & $95\% \pm 5\% \text{ RH}$ to the Class Temperature ¹	30 minutes	6:30
6	Hold at Class Temperature ¹	1 hour	7:30
7	Change Temperature from the Class Temperature ¹ to $23\text{ }^{\circ} \pm 5\text{ }^{\circ}\text{C}$ & $50\% \pm 5\% \text{ RH}$	30 minutes	8:00

¹ Refers to Table 3.

- 7.4.2 Wrap each of the conditioned test specimens around a mandrel with a diameter equal to four times the nominal ID of the test specimen at a uniform rate of one turn per 10 seconds. Visually inspect each specimen for any sign of degradation. Record and report any change in appearance and signs of degradation.

7.5 Flammability

Conduct horizontal burn test, calculate and record burn rate of each test specimen following the guidelines as established in SAE J369 (ISO 3795). Record and report as required by the customer.

7.6 Low Temperature Flexibility

- 7.6.1 Assemble test specimens by inserting a taped wire bundle into a 450 mm length of harness covering sample. The wire bundle shall have a diameter equal to 80% of the ID of sample. Condition test specimens in a $-40\text{ }^{\circ}\text{C} \pm 2\text{ }^{\circ}\text{C}$ cold chamber for 4 hours.
- 7.6.2 Remove test specimens from cold chamber and condition them at $23\text{ }^{\circ}\text{C} \pm 5\text{ }^{\circ}\text{C}$ and $50\% \pm 5\%$ relative humidity for 4 hours.
- 7.6.3 Wrap the test specimens around a mandrel with a diameter equal to four times the nominal ID of the test specimen at a uniform rate of one turn per 10 seconds.
- 7.6.4 Visually inspect each specimen for any sign of degradation. Record and report any change in appearance and signs of degradation.

7.7 Fluids Resistance

- 7.7.1 Prepare 3 specimens for each test fluid.

This document is now
POOBLIC

- 7.7.2 Immerse each set of test specimens in each test fluid specified in Table 5 for 5 minutes. Take precautions to ensure that at least 10 mm from each end of the sample is not exposed to the fluid. For exposures to engine coolant, engine oil, power steering and transmission fluids, ensure that fluid and samples are aged at the specified temperature for 5 minutes. For exposures to diesel fuel, gasohol and gasoline, ensure that fluid is saturated by a non-immersion technique until dripping occurs.
- 7.7.2.1 Solutions are determined as % by volume.
- 7.7.2.2 See SAE J1128 (Table C) for reference standard sources as denoted in Table 5.
- 7.7.3 Remove each specimen from test fluid and allow it to drain for 20 minutes. Let samples condition $23^{\circ}\text{C} \pm 5^{\circ}\text{C}$ for 72 hours.
- 7.7.4 Visually inspect each specimen for any sign of degradation after 1, 24, 48 and 72 hours. Wrap each bundle a complete 360 degrees around a mandrel with a diameter equal to four times the nominal ID of the test specimen at a uniform rate of one turn per 10 seconds. Record and report any change in appearance, signs of degradation or loss of flexibility.

TABLE 5

Fluid Name	Reference Standard	Test Temperature ($^{\circ}\text{C}$)
Engine Oil	ASTM D 471,IRM-902	50 ± 3
Gasoline	ASTM D 471, Ref. Fuel C	23 ± 5
Gasohol	10% Ethanol + 90% ASTM D 471, Ref. Fuel C	23 ± 5
Diesel Fuel	90 % ASTM D 471, IRM-903 + 10% p-xylene	23 ± 5
Power Steering	ASTM D 471, IRM-903	50 ± 3
Auto Trans	Dextron III, SAE J311	50 ± 3
Engine Coolant	50% distilled Water + 50% Ethylene Glycol	50 ± 3
Battery Acid	H ₂ SO ₄ , Specific Gravity = 1.260 ± 0.005	23 ± 5

7.8 Fogging

- 7.8.1 Conduct the Fogging Test according to SAE J1756 using either the Photometric Method or the Gravimetric Method per agreement between customer and the supplier.
- 7.8.2 The test duration is to be specified by the customer.
- 7.8.3 Report Fog Number when using the Photometric Method; and Fog Mass when using the Gravimetric Method or as required by the customer.

7.9 Component Compatibility

- 7.9.1 Assemble components and test as specified by customer.
- 7.9.2 Test to be performed at rated temperature as required by Class specified (refer to Table 3) with no loss of functionality observed.



7.10 Noise Suppression

7.10.1 Noise Suppression is a comparative test and its requirements are to be established by the customer. It is recommended that testing be conducted with a reference standard of known or acceptable noise suppression performance level.

7.10.2 TEST APPARATUS

7.10.2.1 *Insulating Cabinet*

Provides a 30 dB attenuation of the laboratory ambient noise.

7.10.2.2 *Excitation Equipment*

The excitation of test equipment is created by a signal generator and amplified. The power amplifier runs a vibrator. The axle of the vibrator goes through a hole inside the cabinet and is fixed to the equipment.

7.10.2.3 *Noise Measurement*

The microphone is inside the cabinet and connected to an integrating sonometer outside the cabinet. The microphone is fixed at 150 mm from the noisy contact of the wirebundle and steel plate.

7.10.3 TEST SET-UP

7.10.3.1 *Rattling Test Set-Up*

See Figure 1.

7.10.3.2 *Rubbing Test Set-Up*

See Figure 2.

This document is now
POOBLIC

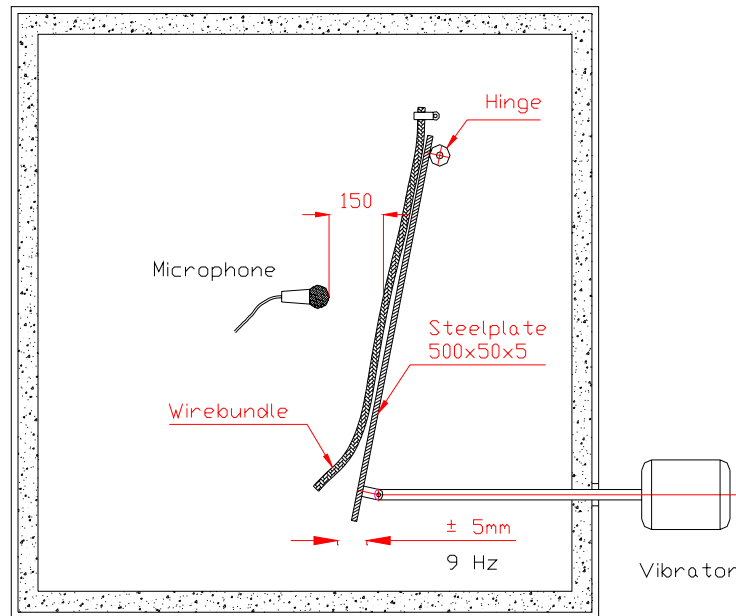


FIGURE 1—RATTLING TEST SET-UP

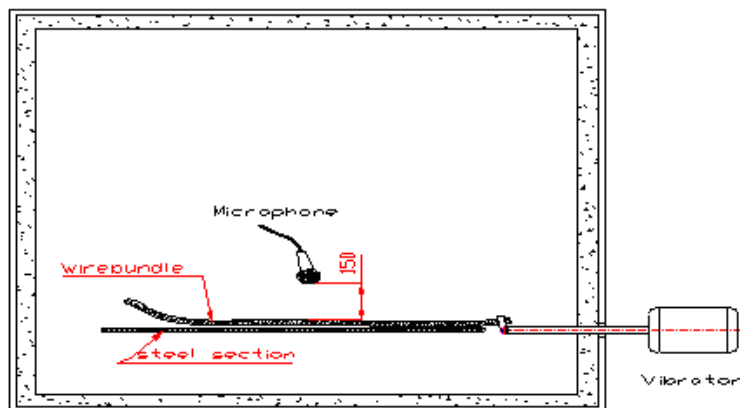


FIGURE 2—RUBBING TEST SET-UP

7.10.4 TEST PROCEDURE

- 7.10.4.1 Run the test on the steel panel without the wire bundle following the Rattling or Rubbing Test set-up illustration. This provides the background noise (A) inside the cabinet.
- 7.10.4.2 Affix wire bundle without harness covering along the steel plate and run the test again. The noise level (B) is measured.

This document is now
POOBLIC

7.10.4.3 Affix wire bundle with harness covering material on the wire bundle and run the test. The noise level (C) is measured.

7.10.4.4 Noise Attenuation in dB is the difference between the noise level B and the noise level C. Record Noise Attenuation Level.

7.11 Abrasion Resistance

7.11.1 Abrasion resistance is a comparative test and its requirements are to be established by the customer. It is recommended that testing be conducted with a reference standard of known or acceptable abrasion resistance performance level.

7.11.2 Test eight (8) 250 mm long samples for each harness covering following the SAE ARP1536A, Abrasion Test Procedure for Chafe Guard, for tubing and sleeving materials. Modify the SAE ARP1536A Abrasion Tester by replacing the hose with a stainless steel mandrel and/or replacing the 1134-gram (2.5-lb) weight with 2268-gram (5-lb) weight. An alternate test procedure may be used if agreed upon between supplier and customer.

7.11.3 [COMBINE WITH 8.11.2] Record the number of cycles to failure of each test specimen. Average the test results of six test specimens by excluding the highest and the lowest values. Report the relative performance of the sample of interest as x times of the Reference Sample.

7.12 Puncture/Pinch

7.12.1 Conduct testing per ASTM F 1306, Test Method for Slow Rate Penetration Resistance of Flexible Barrier Films, or as required by the customer.

7.12.2 Record and report as required by the customer.

7.13 Dynamic Cut-Through

7.13.1 Conduct testing per ASTM D 3032, Standard Test Methods for Hookup Wire Insulation, Section 22 – Dynamic Cut Through, or as required by the customer.

7.13.2 Record and report as required by the customer.

7.14 Impact Resistance Test (Convolute Only)

7.14.1 TEST SET-UP

This document is now
POOBLIC

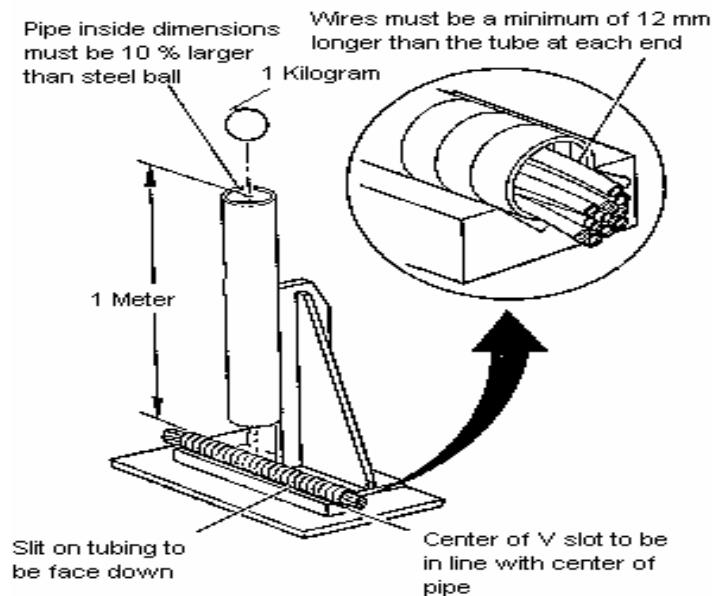


FIGURE 3

7.14.2 TEST PROCEDURE

7.14.2.1 Condition five (5) 400 mm long samples of slit convolute tubing.

7.14.2.2 Insert an untapped wire bundle equal 80% of the tube ID into each convolute tube sample as shown in FIGURE.

7.14.2.3 Fix the test specimen on the V-channel with its slit down.

7.14.2.4 Drop a 1-kilogram steel ball through a guiding tube from a height of 1 meter onto the bundle.

7.14.2.5 Visually inspect the tubing for cracks.

7.14.2.6 Record and report as required by the customer.

7.15 Thermal Insulation

7.15.1 Thermal insulation is a comparative test and its requirements are to be specified by the customer. It is recommended that testing be conducted with a reference standard of known or acceptable thermal effectiveness.

7.15.2 There are two types of Thermal Insulation:

7.15.2.1 Insulate a Part from an External Heat Source. Conduct testing per SAE J2302, Thermal Effectiveness of Sleeve Insulation.

7.15.2.2 Insulate an Internal Heat Source. Conduct testing per SAE J2495, Thermal Containment Efficiency of Sleeve Materials.

This document is now
POOBLIC

8. *Product Appearance and Quality*

When received at the customer's manufacturing site, the product shall have a consistent and clean appearance. All surfaces shall be free of flaws, cracks, and noticeable flash.

9. *Supplier Responsibility*

Parts submitted per this specification must be equivalent to that originally approved. Supplier must submit a process capability study report with the test results prior to product approval. Changes in formulation or processing shall not be made without prior approval.

10. *Toxicology Conformance*

Substance restrictions imposed by law, regulations or customer requirements, apply to the materials/products address by this specification.

11. *Product Approval*

Products defined by this specification must have prior approval by the responsible Engineering function of the customer. Upon request, the supplier shall submit to the affected customer a completed copy of their laboratory test reports. Signed by a qualified and authorized representative of the test facility, demonstrating full compliance with all the requirements of the specification, the material designation and code number, and test specimens for customer evaluation. Customer approval of a product will be based on its performance to this specification and on assessment of suitability for intended processes and/or applications.

PREPARED BY THE HARNESS COVERINGS TASK FORCE COMMITTEE

This document is now
POOBLIC